

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

Iron _____	Located In:	Corner Code #
(County)		
1. Public Land Survey	T 46N R 34W	C8
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling In Section	S 22 T 46N R 34W	2
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp &amp; File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

C8 Aug 17 1998  
 2 Aug 03 1998

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

**A. Description of original monument and accessories and/or subsequent restoration:**


(C8) Quarter corner common to Sections 19-20. Corner reestablished in 1986 by Keith L. Sackett, RLS "Original monument and accessories not found. Restored midway and on line between corners north and south. Fits excellent with stream north. Set 1" ID x 32" IP with 4" alum cap. 8" Spruce N70W 23.5', 4" Balsam S50W 4.8', 8" Baslxam S62E 18.1".  
 (2-Sec. 22) East 1/16 corner between Sections 15-22. Corner not established in the original survey. Found no subsequent record.

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

(C8) Recovered the 1986 monument as described, in good condition, set loosely in a mound of rock, projecting 24", and at record bearing and distance from two of the 1986 witnesses: The Balsam SE, now dead, and the B. Spruce NW, in good condition. The monument was recovered 0.51' North and 4.3' West of the position intended in 1986. This corner is being recorded in order to update the accessories. I fired the monument with more rock. It is now set in a 2.5' dia. x 12" high mound. Corner recovered and re-witnessed by D.Lampela and B.Wheeler, Baraga District Office.  
 (2-Sec. 22) Found no evidence of prior monumentation at the corner position. Established the corner on a line of mean true bearing between reestablished quarter corner 19.9721 ch. West and re-monumented original meander corner 8.5883 ch. East, the position being 20 chains, proportionate to the original record, east of the quarter corner. At the position for the corner I placed a 1" I.D. x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by D.Lampela and B.Wheeler, Baraga District Office.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

(C8) Found 1" pipe with 4" MDNR cap.	(2) Set 1" pipe with 4" MDNR cap.
Blazed and scribed the following:	Blazed and scribed the following:
8" B. Spruce S58E 22.5' 1/4S N8T	8" Double Spruce N73E 6.8' 1/16S BT
14" W. Pine S18E 41.7' do	3" Spruce S06W 7.0' do
10" B. Spruce S64W 30.6' do	10" Spruce S64W 23.6' do
The 1986 witness:	12" Cedar N64W 25.5' do
9" B. Spruce N67W 23.5' marks visible	Squared a 10" Spruce North 2.2' to tree
A squared B. Spruce post is NW'ly 1.5'.	center. Distances are to meas. notch.
Distances are to meas. notch. Bearings are magnetic.	Bearings are magnetic.

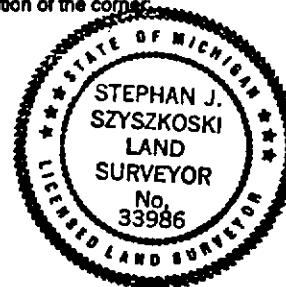

Signed by Stephan J. Szyszkoski  
 Surveyor's Michigan License No. 33986

Date 12/29/98

For the Michigan Department of Natural Resources - Forest Management Division