

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

45.

For corners in

Iron _____ (County)	Located In:	Corner Code #
1. Public Land Survey	T 46N R 34W	H7
	T 46N R 34W	K7
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

K7 Aug 05 1998
H7 Aug 03 1998

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	16	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

(H7) Quarter corner common to Sections 15-22. Corner established in 1852 by Zelotes B. Searles: "40.00 Set quarter Section post. Fir 4 S36E 18. Fir 8 N40W 27."

(K7) Corner common to Sections 13-14-23-24. Previous recordation by Robert E. Schaeling, RLS 8317, dated Sept. 11, 1980 and filed in Liber 28 of Land Corner Records, Page 37, Iron County Records. Schaeling's monument is described as a 1" dia. 4' long galvanized iron pipe with brass cap. His witnesses: Red Maple 11" N28E 18.0' (S13 R34W N.B.T.), Yellow Birch 14" S46E 42.6' (S24 T46N N.B.T.), Red Maple 7" S38W 34.0' (S23 R34W N.B.T.), White Cedar 13" N45W 29.7' (S14 T46N N.B.T.)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


(H7) Original post and accessories were not recovered. Found no acceptable evidence of the position of the original corner on the ground. Reestablished the corner by single proportionate measurement to the original record on a line of mean true bearing between reestablished Section corner 39.9460 ch. West (40.00 R) and original meander corner 28.5604 ch. East (28.6 R). At the position for the corner I placed a 1" I.D. x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by D.Lampela and B.Wheeler, Baraga District Office.

(K7) Recovered the 1980 monument, as described, a 1" iron pipe capped with a 3.5" dia brass tablet stamped "HEAD T46N R34W 13,14,23,24 RLS-8317 1980", projecting about 1.7 ft., in good condition, and at record bearing and distance from 3 of the 1980 witnesses. The Yellow Birch NBT was not recovered. I left the monument in place and marked 1 new accessory as described below. Corner recovered and re-witnessed by D.Lampela and B.Wheeler, Baraga District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(H7) Set 1" pipe with 4" MDNR cap.
Blazed and scribed the following:
7' B. Spruce N81E 19.1' "1/4S NBT"
6' B. Spruce S38E 5.3' do
7' B. Spruce S39W 7.7' do
6' B. Spruce N38W 3.1' do
Placed a squared B.Spruce post adjacent.
Distances are to meas. notch. Bearings
are magnetic.

(K7) Found 1" pipe with 3.5" brass HEAD
cap. Blazed and scribed the following:
8" Maple S85W 11.5' "S23 NBT"
The 1980 witnesses are as noted above.
A squared cedar post is 2 ft. northerly
of the monument. Distance is to meas.
notch. Bearing is magnetic.

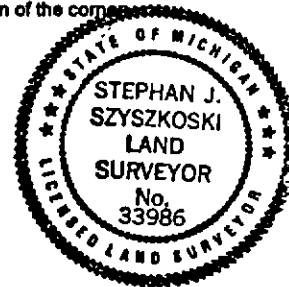

Signed by Stephan J. Szyszkoski
Surveyor's Michigan License No. 33986

Date 12/29/98

For the Michigan Department of Natural Resources - Forest Management Division