

SURVEY & REMONUMENTATION

JAN 12 1996

COMMISSION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
HOUGHTON & IRON
(County)

Located In: Corner Code #

- | | | |
|------------------------------------|------------------------------|----------|
| 1. Public Land Survey | T <u>47-46N</u> R <u>37W</u> | K-1 K-13 |
| | T ___ R ___ | _____ |
| | T ___ R ___ | _____ |
| | T ___ R ___ | _____ |
| 2. Property Controlling in Section | S ___ T ___ R ___ | _____ |
| | S ___ T ___ R ___ | _____ |
| 3. Miscellaneous Property In Sec. | S ___ T ___ R ___ | _____ |
| | S ___ T ___ R ___ | _____ |

REGISTERS OFFICE)
IRON COUNTY, MICH.) ..SS
RECEIVED FOR RECORD THE 15TH DAY OF
MARCH A.D. 19 95 AT
3:45 O'CLOCK P. M. AND RECORDED IN LIBER
6 OF L.C. RECORDS
ON PAGE 386
Mark Selms
DEPUTY REGISTER OF DEEDS
Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Section corner, Sections 35, 36, 1, 2; T.47-46N., R.37W.

I, Richard L. Drahn, in a field survey on December 6, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
2	5	5	4	3	2							
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:

Corner established by John Burt, U.S. Deputy Surveyor, on June 15, 1847.
Original bearing trees:

Hemlock	12"	N.16°E.	21 links	(13.86 feet)
Hemlock	20"	N.22°W.	20 links	(13.20 feet)
Maple	18"	S.16°E.	38 links	(25.08 feet)
Hemlock	24"	S.57°W.	24 links	(15.84 feet)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No evidence of original corner or bearing trees. Restored corner position from natural feature ties north to enter swamp and lake, east to top of ridge, south and west to swamp edges. Retracement distances north, east and west to recovered corners are in accordance with the original field notes.

PEER GROUP APPROVED
Iron County Rep. 4-7-94
COUNTY REPRESENTATIVE


Research on file with County Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

At the corner position I set a standard 2" diameter by 30" long split base aluminum monument with a 3 1/2" aluminum cap stamped to read: T.47-46N., R.37W.; S.35, S.36, S.1, S.2; 1993; R.L.S. 21564: from which I established the following new blazed and scribed bearing trees and/or reference objects:

20"	Sugar Maple	N.21°E.	11.19 feet
10"	Sugar Maple	S.30°E.	17.41 feet
10"	Sugar Maple	S.45°W.	12.69 feet

A 6' steel sign post bears: S.79°W. 0.57 feet.

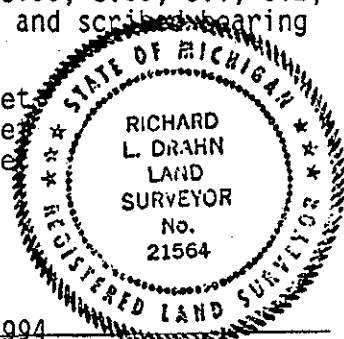

Signed by Richard L. Drahn Date February 16, 1994

Surveyor's Michigan License No. 21564

U.S.F.S. 7-24
A-21

LIBER **6** PAGE **386**