

**JACKSON COUNTY
APPROVED LAND CORNER
P.A. 745 of 1970**

Acting
Chairman Dean R. Gutekunst

Date 3-11-98

WEST 1/4 POST, SECTION 23
NORVELL TOWNSHIP

**LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in
JACKSON
(County)

Located In: Corner Code #

- | | | |
|------------------------------------|---------------------------|------------|
| 1. Public Land Survey | T <u>4</u> S R <u>2</u> E | <u>I-8</u> |
| | T _____ R _____ | |
| | T _____ R _____ | |
| | T _____ R _____ | |
| 2. Property Controlling in Section | S _____ T _____ R _____ | |
| 3. Miscellaneous Property in Sec. | S _____ T _____ R _____ | |

**SURVEY &
REMONUMENTATION**

SEP 16 1998

#2064471
Liber 1563 Page 1017
Page 1 of 2
Jackson Co., MI
Recorded
03/12/1998 12:43P
Mindy Reilly
Register of Deeds

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

SECTION

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	13	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, DEAN R. GUTEKUNST, in a field survey on August 21, 1997, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- Original Government Post set by Hervey Parke, Deputy Surveyor, February 1824.
- W. Oak 18" N 76 W 61 links (40.26')
- Y. Oak 12" N 15 E 61 links (40.26')
- Perpetuation by O. Curtiss, no date
- Hickory 12" S 19 1/2 W 22 1/2 links (14.85')
- Hickory 18" N 63 1/2 E 33 links (21.78')

No description

Continued on back,

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found FIRECLAY, with Richard E. Gutekunst, RLS #7863 capped iron on North side. Corner is at the North edge of Waterman Road (gravel) and in line of occupation North and South.

Accepted FIRECLAY as a careful and faithful perpetuation of the position of the original corner as remonumented by LaRue in 1884.

Set a Standard Jackson County Monument to replace the fireclay and left the top 15" of the fireclay on the North side of the Harrison monument and the iron on the Northwest side and the broken fireclay pieces below the Harrison monument.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-8 T4S, R2E Corner is a 4" diameter X 30" Cast Iron Harrison monument with a brass cap stamped LS 18658, which is a standard monument for Jackson County.

- | | | | |
|-------------|----------------|--------|---|
| * S 3 E | 47" W. Oak | 36.11' | Pole barn spike & washer on West side. |
| ** S 69 W | 26" Hickory | 89.20' | Pole barn spike & washer on South side. |
| *** N 23 W | 21" Oak | 20.95' | Pole barn spike & washer on West side. |
| **** N 78 E | 27" Oak | 97.10' | Pole barn spike & washer on South side. |
| N 20 E | 9" Hickory | 26.26' | Pole barn spike & washer on East side. |
| N 15 E | 2 1/2" Hickory | 18.0' | No nail, center line of tree. |


North Steel post and survey marker sign attached 20'

Signed by Dean R. Gutekunst

Date March 1, 1998

Surveyor's Michigan License No. 18658

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, MAY 28, 1987

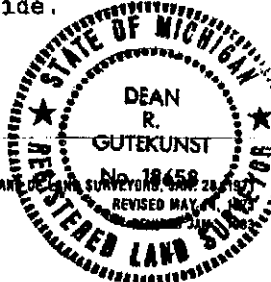

- A.) - Perpetuation by B.F. LaRue, December 11, 1884
- | | | |
|--------------------|--------------------|---|
| W. Oak 8" N 11½ E | 58 links (38.28') | - Found stake by witness taken by O. Curtiss. |
| *W. Oak 14" S 3 E | 54½ links (35.97') | - Broken Brick. |
| W. Oak 14" S 26½ W | 55½ links (36.63') | |
- Perpetuation by the Jackson County Road Commission, no date. - Fireclay
- | | | |
|--------------|-----------|--------|
| 14" W. Oak | N 11-30 E | 38.28' |
| 10" R. Oak | S 45 E | 60.0' |
| * 14" W. Oak | S 3 E | 35.97' |
| 14" W. Oak | S 26-30 W | 36.63' |
- Perpetuation by Richard E. Gutekunst, RLS #7863, dated August 11, 1972.
- Found Fireclay , set capped iron
- | | | |
|-------------|-------------|--------|
| * S 3 E | 37" W. Oak | 36.28' |
| ** S 69 W | 19" Hickory | 89.25' |
| *** N 23 W | 13" Oak | 20.72' |
| **** N 78 E | 17" Oak | 97.19' |
- Not recorded in P.A. - 74.

SURVEY &
REMONUMENTATION

SEP 16 1998

SECTION