

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

KALKASKA Located In: \_\_\_\_\_ Corner Code # \_\_\_\_\_  
 \_\_\_\_\_  
 (County)  
 1998 REMONUMENTATION  
 1. Public Land Survey T 25N R 7W E-5 \_\_\_\_\_  
 T \_\_\_\_\_ R \_\_\_\_\_  
 T \_\_\_\_\_ R \_\_\_\_\_  
 T \_\_\_\_\_ R \_\_\_\_\_  
 2. Property Controlling S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
 in Section S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
 3. Miscellaneous S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
 Property in Sec. S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

**SURVEY &  
 REMONUMENTATION**

FEB 22 1999

SECTION

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

I, EUGENE FARRIER, in a field survey on October 28, 1998, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.**

	A	B	C	D	E	F	G	H	I	J	K	L
1												
2	6		5			4		3		2		1
3												
4	7		8			9		10		11		12
5												
6	18		17			16		15		14		13
7												
8	19		20			21		22		23		24
9												
10	30		29			28		27		26		25
11												
12	31		32			33		34		35		36
13												

A. Description of original monument and accessories and/or subsequent restoration:

**E-5: Sec. Cor. Common to Secs. 8, 9, 16, & 17, T25N-R7W, Garfield Township**  
 1853, Subd. of Twp, by Deputy Surveyor T. Whelpley; set post; Hemlock 18", N 58°W, 30 Lk. (19.80'); Hemlock 20", N 16°E, 7 Lk. (4.62'); Y. Birch 14", S 12°E, 48 Lk. (31.66')  
 1905, Sec. sub. survey by W.S. Merrill CS, Co. Survey Bk. Pg. 38 & Pg. 45; fd. original witness  
 1908, Sec. sub. survey by W.S. Merrill CS, Co. Survey Bk. Pg. 38 & Pg. 45; fd. original witness  
 1914, Sec. sub survey by W.S. Merrill CS, FB # 34, Pg. 87; shows finding corner  
 1958, Road survey by W.R. Dowey RLS, with M.S.H.D.; found 3/4" pipe; N 53°E, 43.55' cor. fence post; S 45°W, 49.35' telephone pole; S 51°E, 43.28' telephone pole.  
 10-3-75, J. Fletcher, found 1 1/4" bolt spike in mon. box, Liber 1, Pg. 722, Cert. of Survey  
 10-3-75, J. Fletcher, found 1 1/4" bolt spike in mon. box, Liber 1, Pg. 723, Cert. of Survey  
 10-3-75, J. Fletcher, found 1 1/4" bolt spike in mon. box, Liber 1, Pg. 724, Cert. of Survey  
 10-3-75, J. Fletcher, found 1 1/4" bolt spike in mon. box, Liber 1, Pg. 725, Cert. of Survey  
 10-3-75, J. Fletcher, shows corner only, Liber 1, Pg. 729, Cert. of Survey  
 10-3-75, J. Fletcher, found 1 1/4" bolt spike in mon. box, Liber 1, Pg. 758, Cert. of Survey  
 10-3-76, J. Fletcher, found 1 1/4" bolt spike in mon. box, Liber 1, Pg. 726, Cert. of Survey  
 10-3-76, J. Fletcher, found 1 1/4" bolt spike in mon. box, Liber 1, Pg. 727, Cert. of Survey  
 10-3-76, J. Fletcher, found 1 1/4" bolt spike in mon. box, Liber 1, Pg. 728, Cert. of Survey  
 12-8-89, E. Farrier, found 1 1/4" bolt spike in mon. box 4.12' West of centerline M-66, LCRC, Liber 2, Pg. 394

**Ratified by Peer Group**  
**P.A. 345 - 1990 Kalkaska County**  
 Chairman Eugene Farrier  
 Date 2-2-99

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


**E-5: Sec. Cor. Common to Secs. 8, 9, 16, & 17, T25N-R7W, Garfield Township**  
 Found and accepted 1 1/4" bolt spike in mon. box, 4.1' West of M-66 and in centerline of East-West Road (as recorded in LCRC and previous Cert. of Surveys) Pulled and set 5/8" X 18" re-bar w/bras cap.  
 S34°E, 111.77' - 6" R. Pine, found nail  
 No G.L.O. witnesses were found.  
 Kalkaska County Peer Group accepted the above monument as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

**E-5: Sec. Cor. Common to Secs. 8, 9, 16, & 17, T25N-R7W, Garfield Township**  
 Found and accepted 1 1/4" bolt spike in mon. box, 4.1' West of M-66 and in centerline of East-West Road (as recorded in LCRC and previous Cert. of Surveys) Pulled and set 5/8" X 18" re-bar w/bras cap.  
 N62°W, 75.92' - Power pole, set nail  
 S50°E, 96.48' - 12" R. Pine, set nail  
 S34°E, 111.77' - 6" R. Pine, found nail  
 S65°W, 78.27' - Power pole, set nail

Signed by Eugene Farrier  
 Michigan License No. 24594

Date 2-8-99

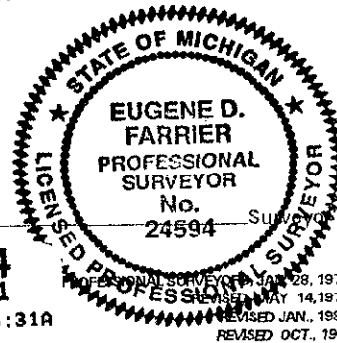

**3012654**  
 Page: 1 of 1  
 02/10/1999 08:31A  
 LB: 5 PG: 309

REVISIONS: JAN. 1977, MAY 14, 1977, REVISED JAN. 1988, REVISED OCT. 1998