

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

KALKASKA
 (County)

Located In:

Corner Code #

1999 REMONUMENTATION

1. Public Land Survey

T 25N R 7W

G-6

T R

T R

T R

2. Property Controlling
 in Section

S

T R

S

T R

3. Miscellaneous
 Property in Sec.

S

T R

S

T R

RECORDED &
 INDEXED
 MAR 12 2000

SECTION



Kalkaska County Joan Hall, Register

3020171
 Page: 1 of 1
 02/04/2000 03:40P
 REMON
 LB: 6 PG: 117

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

I, EUGENE FARRIER, in a field survey on November 4, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G-6: 1/4 Cor. Common to Sec. 15 & 16, T25N-R7W, Garfield Township

1853, G.L.O. Resurvey, by V.W. Caukin (Deputy Surveyor) Co. Survey Notes Pg 46, set 1/4 post, Beach 8", S67°W, 45 Lks (29.7'); Beach 6", S57.25°E, 50 Lks (33')

1905, Survey, by W.S. Merrill (Co. Surveyor) Co Survey Bk 22, Pg. 44-46, Elm stake (Birch 10", N43°W, 35.5 Lks (23.43')

1981, LCRC & Survey, by E. Farrier (Co. Surveyor) (LCRC recorded in Liber 2, Pg. 303), set 1/2" X 3' rod & cap RLS # 24594, 8' East of centerline of N-S road on line between NW corner & SW corner, N65°E, 40.88', 5" R. Pine; S32°E, 58.93', 5" R. Pine; S51°W, 68.25', 14" Maple, S77°W, 37.52', power pole; N08°W, 52.72', 1/2" iron (bad 1/4 cor.)

1998, Survey, by E. Farrier (Co. Surveyor), found same as Farrier (1981)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

G-6: 1/4 Cor. Common to Sec. 15 & 16, T25N-R7W, Garfield Township

Found and accepted 1/2" rerod w/ cap #24594, 3' East of centerline N-S road & 20' +/- South of tree line to West.

N20°E, 79.65', 2" Cherry, set nail & washer

N75°E, 22.74', 4" Elm, set nail & washer

S40°E, 53.52', 10" R. Pine, set nail & washer

S81°W, 37.60', power pole, set nail & washer


N08°W, 52.72', 1/2" iron set G.F.A.

No G.L.O. witnesses were found.

Ratified by Peer Group
 P.A. 345 - 1990 Kalkaska County

Chairman Eugene Farrier

Date 02-03-00

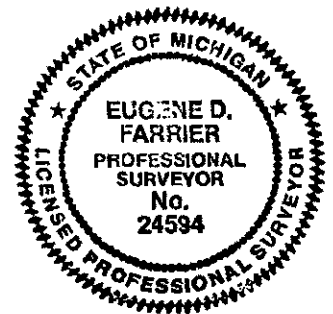

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

G-6: 1/4 Cor. Common to Sec. 15 & 16, T25N-R7W, Garfield Township

Found and accepted 1/2" rerod w/ cap #24594, 3' East of centerline N-S road & 20' +/- South of tree line to West. Pulled & set 5/8" X 18" rerod w/ brass cap.

N20°E, 79.65', 2" Cherry, set nail & washer

N75°E, 22.74', 4" Elm, set nail & washer

S40°E, 53.52', 10" R. Pine, set nail & washer

S81°W, 37.60', power pole, set nail & washer

N08°W, 52.72', 1/2" iron set G.F.A.

Kalkaska County Peer Group accepted the above monument as a careful and faithful reestablishment of the position of the original corner.

Signed by Eugene Farrier
 Michigan License No. 24594

Date 02-04-00 Surveyor's