

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. PA 1970

For Corners In:
Kalkaska Located In _____ Corner Code # _____
(County)


- | | | | | | |
|--------------------------------------|---|------------|---|-----------|-----------|
| 1. Public Land Survey | T | <u>26N</u> | R | <u>5W</u> | <u>C7</u> |
| | T | _____ | R | _____ | _____ |
| 2. Property Controlling in Section | S | _____ | T | _____ | R |
| | S | _____ | T | _____ | R |
| 3. Miscellaneous Property in Section | S | _____ | T | _____ | R |
| | S | _____ | T | _____ | R |

4. Lot No: _____ Recorded Plat: _____

5. Private Claims: _____

I, Craig W. McVean, in a field survey on April 14, 2009 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

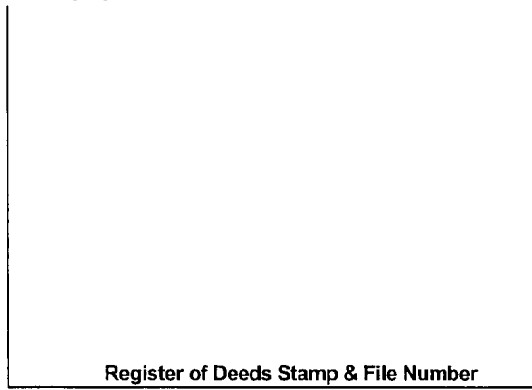

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7			●										
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:


- C7 – 1852 – Set post – G. H. Cannon
 1) Beech 14" S38°E 30 L.
 2) Beech 10" N69°W 15 L.
 - 1956 – DNR Cor. record – B. Buckley
 1" pipe with 4" Brass Cap by double proportionate measure.
 3) 8" R. Pine S24°W 192 L.
 4) 14" Double Maple N16½°E 259 L.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

C7 – Section Corner common to Sections 17, 18, 19 & 20 – Fd. 4" DOC (DNR) Brass Cap on 1" iron pipe. Found Witnesses as follows #1 & 2 – gone, #3 – good and #4 is gone. E – W ORV trail is 60'± South. DOC Monument accepted as a careful and faithful reestablishment of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- C7 – 4" DOC (DNR) Brass Cap on 1" iron pipe
 Set Blue Carsonite Post 1' North
 S24°W 127.21' to set N & T in E. side 27" R. Pine (#3)
 S19°W 21.46' to set N & T at fd. nail in E. side 12" Tw. W. Pine
 East 97.96' to set N & T at fd. nail in E. side 21" R. Pine scribed 'XBT'
 N87°W 50.19' to set N & T at fd. nail in S. side 6" Cherry
 N15°W 91.22' to set N & T in W. side 11" R. Pine scribed 'XBT'

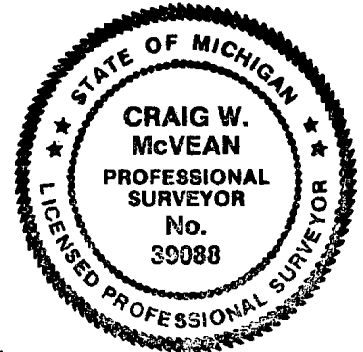

Signed by: Craig W. McVean
 Surveyor's Michigan License No.: 39088

Date: 11/23/2009