

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. PA 1970

For Corners In: Kalkaska Located In _____ Corner Code # _____
(County)


1. Public Land Survey T 26N R 6W K9
T _____ R _____

2. Property Controlling in Section S _____ T _____ R _____
S _____ T _____ R _____

3. Miscellaneous Property in Section S _____ T _____ R _____
S _____ T _____ R _____

4. Lot No: _____ Recorded Plat: _____

5. Private Claims: _____

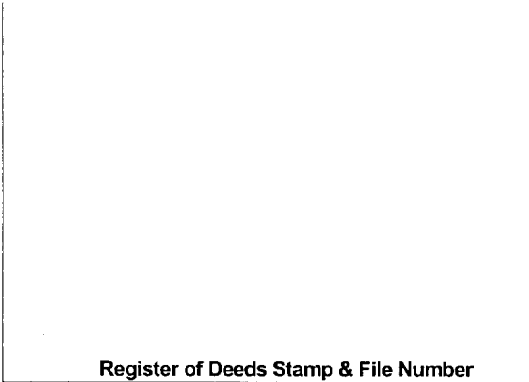

I, Craig W. McVean, in a field survey on April 4, 2009 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

- K9 – 1852 – GLO – Set Post – G. H. Cannon
 - 1) W. Pine 36" N75°E 28 L.
 - 2) Beech 10" S85°W 23 L.
- 1955 – DNR Cor. record – D. C. DeLaMater. This corner was found by Forestry division survey crew while making partial resurvey of this area. One original BT still in place in good condition. 1" pipe with 4" Brass Cap.
- 3) 12" Cherry N28°E 62 L.
- 1972 – Rec. Survey – L. 1, p. 141 – C. E. Ostling – Fd. Forestry Corner; 3) 12" Cherry N28°E 40.92'
- 1975 – LCRC L. 1, p. 363 & Rec. Survey L. 1, p. 880 – H. L. Fluharty Fd. 1" pipe with Dept. of Cons. Cap – 18" ± above ground approx 250' West of centerline of dirt rd. 3) 9" Tw. Cherry N30°E 41.02'; 4) 8" Maple in clp. N72°W 26.94'; 5) 6" Pine S25°W 10.40'
- 1975 – Rec. Survey L. 1, p. 705 – N. F. Parker – Shows corner
- 1978 – Consumer Power Co. Survey – Drawing No. S-F 17406, Sheet 8 – D. A. Ankrom – Fd. DNR Mon.;
- 5) 3" R. Pine S23°W 10.41'; 3) 10" T. Cherry N30°E 41.13';
- 4) 5" Ave. Maple Clump N70°W 27.04';
- 6) 4" R. Pine S20°E 5.61'
- 2000 – Unrecorded Survey – Farrier Surveying – File No. 9400 – E. D. Farrier - DNR Mon.;
- 6) Fd. N & W S15°E 5.63' – 10" R. Pine;
- 7) Set nail N20°W 21.70' – 12" R. Pine;
- 8) Set nail N65°E 23.46' – 14" R. Pine

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

K9 – Section Corner common to Sections 23, 24, 25 & 26, T26N, R6W – Fd. 4" DOC (DNR) Brass Cap on 1" iron pipe. Remains of witnesses #1 in place. DOC Monument accepted as a careful and faithful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K9 – 4" DOC (DNR) Brass Cap on 1" iron pipe – Up 1.2'
Set Blue Carsonite Post 1' SW
S17°E 5.59' to set N & T at fd. nail in E. side 10" R. Pine scribed 'XBT' (#6)
S25°W 10.20' to set N & T in E. side 10" R. Pine (#5)
N75°W 26.76' to fd. 60d nail in N. side 10" R. Maple in Clp – 5 (#4)
N21°W 21.56' to set N & T at fd. nail in E. side 12" R. Pine (#7)
N27°E 40.91' to set N & T in NW side 10" & 8" Twin Cherry and dying (#3)
N58°E 23.39' to set N & T at fd. nail in NW side 14" R. Pine (#8)



Signed by: Craig W. McVean
Surveyor's Michigan License No.: 39088

Date: 11/23/2009