

SURVEY & REMONUMENTATION

FEB 13 1998

SECTION

**LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

<u>KALKASKA</u>	Located In:	Corner Code #
(County)		
1997 REMONUMENTATION		
1. Public Land Survey	T <u>26N</u> R <u>8W</u>	<u>L-8</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6			5		4		3		2		1	
3													
4	7			8		9		10		11		12	
5													
6	18			17		16		15		14		13	
7													
8	19			20		21		22		23		24	
9													
10	30			29		28		27		26		25	
11													
12	31			32		33		34		35		36	
13													

I, EUGENE FARRIER, in a field survey on OCTOBER 30, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:


NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
L-8: 1/4 Cor. Common to Sec. 22, & 23, T26N-R8W, Boardman Township
 1852, GLO resurvey, set post, 9" Sugar S25E, 37, 11" Sugar N65W, 17
 09-16-1912, W.S. Merrill Co. Surveyor, used cor., no accessories
 04-07-1976, J.L. Wilcox #14102, survey, fd. 3/4" iron raised w/1/2" iron & cap, Lib. 1, Pg. 897
 04-07-1976, J.L. Wilcox #14102, LCR, fd. 3/4" iron raised w/1/2" iron & cap, Lib. 1, Pg. 384
 11-23-1977, A.L. Lennox #20357, survey, fd. 1/2" bar & cap #14102, w/ accessories, Lib. 2, Pg. 157
 07-06-1989, Farrier Surveying survey, fd. Iron & cap, w/accessories

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
L-8: 1/4 Cor. Common to Sec. 22, & 23, T26N-R8W, Boardman Township
 Fd. 1/2" iron & cap, could not read cap #, 1' East of C.L. Creighton Rd. & 7' South of Pine row to East. Pulled & replaced with 5/8" x 18" re-bar w/brass cap in mon. box, no GLO witnesses were fd. The Kalkaska Co. Peer group approved & accepted the above monument as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
L-8: 1/4 Cor. Common to Sec. 22, & 23, T26N-R8W, Boardman Township
 Fd. 1/2" iron & cap, could not read cap #, 1' East of C.L. Creighton Rd. & 7' South of Pine row to East. Pulled & replaced with 5/8" x 18" re-bar w/brass cap in mon. box.
 Set nail & tag East, P. Pole, 30.24'
 Fd. nail S08E, P. Pole, 203.33'
 Set nail & tag West, fence post, 35.75'
 Fd. nail N13W 40" Walnut, 198.61'

Ratified by Peer Group
 P.A. 345 - 1990 Kalkaska County
 Chairman Eugene Farrier
 Date 1-29-98

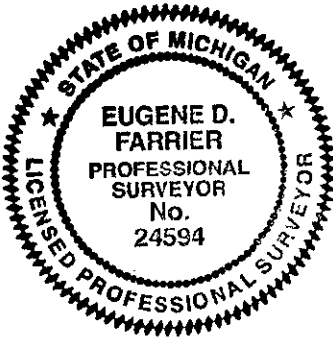

Signed by Eugene Farrier
 Surveyor's Michigan License No. 24594

Date 2-3-98



3004845
 Page: 1 of 1
 02/04/98 11:22A
 LB: 5 PG: 249