

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. 27 ^{N.} <input checked="" type="radio"/> R. 5 ^{W.} <input checked="" type="radio"/>	E-7; F-7; F-9; G-7
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ ^{N.} <input type="radio"/> ^{S.} <input type="radio"/> R. _____ ^{E.} <input type="radio"/> ^{W.} <input type="radio"/>	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ ^{N.} <input type="radio"/> ^{S.} <input type="radio"/> R. _____ ^{E.} <input type="radio"/> ^{W.} <input type="radio"/>	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on March 25, 1976, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. ~~Description of original monument and accessories and of subsequent restoration:~~

C. (continued)

G-7

Set DNR Mon. & Cedar Post
 8" R. Pine S88°W 86.6
 11" R. Pine S62°W 84.8
 Fd. 1½" Pipe S36°34'W 90.92
 11" R. Pine S08°E 64.4

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- E-7 Found ½" rerod and drove 1½"x20" iron rod.
- F-7 Reestablished N¼ Sec. 21 equidistant & on line between fd. section corners to E & W.
- F-9 Recovered previous department monument of record which was a perpetuation of Schaaf corner set from remains of U.S.B.T.'s.
- G-7 Recovered shadow of Schaaf stake bottom from three of Schaaf witnesses.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E-7

Drove 1½"x20" Iron Rod
 16" Oak N36°W 76.0
 12" Oak N57°E 58.1
 Power Pole S42°W 63.63
 cedar post w/loc. tag
 Due E 33

F-7

Set DNR mon. & cedar post
 7" W. Pine N40°E 49.3
 8" R. Pine S62°W 47.1
 6" R. Pine S03°W 56.4
 6" R. Pine S50°E 76.6

F-9

DNR Monument & Cedar Post
 12" R. Pine N65°E 22.3
 12" W. Pine N50°W 36.5
 14" W. Pine S04°W 34.8
 18" W. Pine S50°E 11.7

SIGNED BY Carl F. Roser 4-28-77 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:


SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

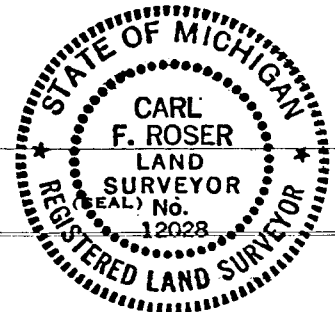

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

BEAR LAKE TOWNSHIP
KALKASKA COUNTY