

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

**SURVEY &  
REMONUMENTATION**

FEB 26 2001

SECTION

<u>KALKASKA</u>	Located In:	Corner Code #
(County)		
2000 REMONUMENTATION		
1. Public Land Survey	<u>T 27N R 7W</u>	<u>E-2</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling	S _____ T _____ R _____	_____
in Section	S _____ T _____ R _____	_____
3. Miscellaneous	S _____ T _____ R _____	_____
Property in Sec.	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5	4		3		2		1		
3												
4	7		8	9		10		11		12		
5												
6	10		17	16		15		14		13		
7												
8	19		20	21		22		23		24		
9												
10	30		29	28		27		26		25		
11												
12	31		32	33		34		35		36		
13												

I, EUGENE FARRIER, in a field survey on August 29, 2000 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

**NOTE:** Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

**A. Description of original monument and accessories and/or subsequent restoration:**

**E-2: 1/4 Cor. Common to Secs. 4 & 5, T27N-R7W, Kalkaska Township**  
1850, G.L.O. Resurvey, by Lucius Lyon, set Beech post for 1/4 corner, Sugar 10", S89°W, 13 Lks; Sugar 12", N78°E, 24 Lks  
1903, Survey, by W. S. Merrill (Co. Surveyor), Ek 8, Pg 8, stone for corner, no accessories  
1972, Survey, by L. Gerschbacher, Liber 1, Pg 184, set 1/2" iron pipe with R.L.S. cap at corner; W. Cherry 14", N80°W, 67.33"; Maple 20", East 63.31"; power pole, S20°E, 97.31'  
1974, Survey, by G.F. De La Mater, Liber 1, Pg 551, found iron & same accessories as 1972 survey above  
1974, Survey, by D.A. Ankrom, Liber 1, Pg 326, found 3/4" pipe at proportionate measurement, 13.12' South of 3/4" rebar, all new accessories  
1975-1976, Survey, by L. Gerschbacher, Liber 1, Pg 660 & 661 & Survey, by G.F. De La Mater, Liber 1, Pg 808, found iron at corner same accessories as 1972 survey above  
1980, Survey, by A.L. Drago, Liber 2, Pg 571, found 3/4" pipe at corner all new accessories  
1980, Survey, by J. Fletcher, Liber 2 pg 608, found 3/4" pipe at corner same accessories as 1980 survey above  
1986, Survey, by E. Farrier (Co. Surveyor) not recorded, set 1/2" rod & cap #24594 by perpetuation of Merrill's Center 1/4 corner and remaining fence line occupation, power pole, S09°E, 109.93"; Maple 20", S80°E, 62.80"; power pole, N30°E, 72.77"; Twin 17" Maple, N80°W, 83.37"; found iron & cap #18990, South 12.78'  
1987, LCRC, by P. Case, Liber 2, Pg 330, for E. Farrier 1986 survey  
1990-1998, Surveys, by E. Farrier (Co. Surveyor) & R. Kral, (3 surveys not recorded) same corner description & accessories as 1986 survey & 1987 LCRC above

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

**E-2: 1/4 Cor. Common to Secs. 4 & 5, T27N-R7W, Kalkaska Township**  
Found 1/2" iron in centerline of Beebe Road 18' South of Kalkaska Auto Road (private) to West. Found 1/2" iron & cap #18990, South 12.78'. No G.L.O. witnesses were found.


**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

**E-2: 1/4 Cor. Common to Secs. 4 & 5, T27N-R7W, Kalkaska Township**  
Pulled & set 5/8" X 18" rod with brass Co. mon  
N35°E, 61.71', power pole, nail & tag  
S80°E, 83.33', 16" Maple, nail & tag  
S85°W, 83.43', 8" Red Pine, nail & tag  
N58°W, 88.51', 20" Twin Maple, nail & tag  
South 12.78', found 1/2" iron & cap #18990  
Kalkaska County Peer Group accepted the above monument as a careful & faithful reestablishment of the position of the original corner.

Ratified by Peer Group  
P.A. 345 - 1990 Kalkaska County

Chairman Eugene Farrier

Date 2-14-01

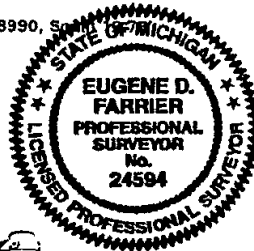

Signed by Eugene Farrier  
Surveyor's Michigan License No. 24594

Date 2-15-01