

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 28 N. R. 7 W.	K-6; L-6; M-6
2. PROPERTY CONTROLLING IN SECTION 13	T. 28 N. R. 7 W.	2
3. MISCELLANEOUS PROPERTY IN SECTION 13	T. 28 N. R. 7 W.	## (between K-5 & L-5 & 670.34 W. of L-5)
4. LOT NO. _____	RECORDED PLAT _____	
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on November 12, 1976, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on November 12, 1976, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. Description of original monument and accessories and for subsequent restoration~~

C. (continued)

2	##
Drove 1 1/4"x18" Iron Rod	Drove 1 1/4"x18" Iron Rod
8" R. Pine N25°E 69.00	P. Pole S38°E 44.56
9" Ironwood S41°E 55.65	5" R. Pine N25°W 48.40
8" Maple S13°E 32.52	5" R. Pine N16°E 47.93
Set cedar post w/loc. tag Due S 33'	Set cedar post w/loc. tag due S 33'
Fd. 1/2" pipe S23°47'W 33.7	

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

-6 Found 2" pipe per Caukins survey of 1919 & C.P.C. survey of 1967; Corner is in line with old fences to E & W, mostly down.

-6 Recovered 4" stake bottom in muck from remains of B.L.Caukins wit. (1919) for center of Sec. 13. Caukins had dry tam. 18" N79 1/2°W 70.6' & we fd. stump & down log showing excellent face, notch & scribes & dry tam. 24" S37 1/2°W 55.4' & we fd. decayed stump & down log.

-6 Fd. 1/2" iron rod per C.P.C. survey 1967 which seems to fit B.L.Caukins survey of Sec. 13 in 1919. Corner is in center of N-S gravel road.

2 Estab. 1/16 corner S.P. Center E-W b'top road is Due N 1.5'.


## Estab. NE corner of W 1/2-NE 1/4-NW 1/4 per standard subdivision of NW 1/4 of Sec. 13.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-6	L-6	M-6
Found 2" Pipe	Drove 1"x72" pipe & ced.post w/loc tag fd. 4" pt. stk. bottom	Drove 1 1/4"x24" pipe over 1/2" rod
12" Ironwood S60°E 22.7	8" B.Cherry N88°W 70.5	14" B.Cherry N22°E 70.75
9" Maple S82°W 31.7	4" B.Cherry N03°E 114.0	P. Pole S26°E 113.15
7" Twn.Maple S40°W 42.8	4" B.Cherry N55°E 41.7	8" Twn.Maple N66°E 82.89
Ctr. N-S dirt trail Due E 3'±	14" Balsam S39°W 149.4	Set cedar post w/loc. tag
Set cedar post w/loc. tag Due E 33'	Ctr. Rapid Rv.8' C-W Due S 128'±	Due W 33'
	Ctr. Rapid Rv.15'C-SW Due E 500'±	

SIGNED BY Carl F. Roser DATE 10-31-77

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

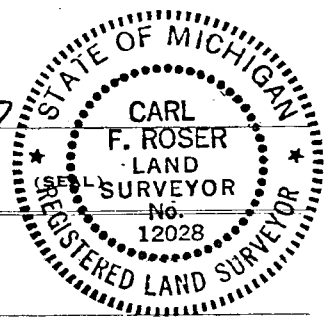

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_  
RAPID RIVER TOWNSHIP  
KALKASKA COUNTY