

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>28</u> <sup>N.</sup> R. <u>7</u> <sup>W.</sup>	<u>I-9; J-9</u>
2. PROPERTY CONTROLLING IN SECTION <u>23</u>	T. <u>28</u> <sup>N.</sup> R. <u>7</u> <sup>W.</sup>	<u>15</u>
3. MISCELLANEOUS PROPERTY IN SECTION <u>23</u>	T. <u>28</u> <sup>N.</sup> R. <u>7</u> <sup>W.</sup>	<u>Z (on line between I-9 &amp; J-9 &amp; 800.0' E of I-9)</u>
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND  
FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74 Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on November 10, 1976, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on November 30, 1976, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. Description of original monument and accessories and/or subsequent restoration:~~

C. (continued)

	Z	
<i>Drive</i>		
1 1/4" x 24" Rod.		
5" S. Pine	S32°W	86.65
4" S. Pine	S22°E	91.60
Cedar Post w/loc. tag		
	Due N	33'

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- I-9 Fd. RR spike that fits witnesses by C.P.C. survey of Sec. 23 in 1967. Corner falls in approximate intersection of gravel roads N-S-E-W.
- J-9 Found 1/2" pipe per C.P.C. survey of Sec. 23, in 1967.
- 15 Established 1/16 corner S.P. Corner is 3.5' N of center of E-W gravel road.
- Z Etab. SE corner of an 800'x800' exception in the SW corner of the SW 1/4-SW 1/4 of Sec.23 per std. sec. subdivision. Corner is 5' N of center of E-W gravel road.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

	<i>Drive</i>		
I-9 Fd. RR spk. & replaced with 1 1/4" x 20" rod	<i>Drive</i> 1" x 18" pipe over 1/2" pipe	J-9 1 1/2" pipe	15 1 1/4" x 18" Rod.
14" Maple S20°E 82.95	8" Maple N54°W 88.3		6" W. Pine N39°E 118.3
9" Twn. Maple S25°W 122.20	12" Maple N22°W 84.6		9" Maple S47°E 133.5
P. Pole S53°W 40.90	8" Maple N09°E 142.7		9" Maple S12°E 137.5
Set cedar post w/loc. tag N45°E 47.7	Cedar post w/loc. tag		Cedar post w/loc. tag
	Due N 33'		Due N 33'
	on Ⓢ powerline SW-NE		

SIGNED BY Carl F. Roser

DATE 10-31-77

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_

DATE \_\_\_\_\_


CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_

DATE \_\_\_\_\_

MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

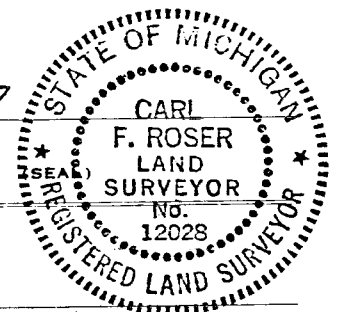

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_

RAPID RIVER TOWNSHIP  
KALKASKA COUNTY

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 28, 1971  
REVISED MAY 14, 1975

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET