

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>28</u> N. <u>5</u> R. <u>5</u> W.	<u>I-11, I-13; J-13</u>
2. PROPERTY CONTROLLING IN SECTION <u>35</u>	T. <u>28</u> N. <u>5</u> R. <u>5</u> W.	<u>8</u>
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ R. _____ W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND
FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on July 20, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. - Description of original monument and accessories and/or subsequent restoration:

C. (continued) 8
 Set 5/8 " X 36" R.Rod & Ced.post
 w/Loc. Tag
 9" Maple S13°W 25.9
 9" Maple S63°W 6.3
 9" Maple N01°W 23.1

- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
- I-11 Recovered D.N.R. Mon. as estab. in previous Dept. Survey (1968) by double proportion. Cor. falls directly under E-W Power line.
 - I-13 Accepted fd. 3/8" B. Spk. as best fitting occupancy & previous surveys in this area.
 - J-13 Estab. 1/4 Cor. equidistant & on line btw. fd. sec. cor's to E & W. Ctr. of E-W Co. Rd. #612 is N. 7.5'+. Fd. M.Schaaf pipe, S31°22'E, 56.90', which we cut off flush w/ground.
 - 8 Estab. 1/8 Cor. per standard B.L.M. instructions.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-11	I-13	J-13
Fd. DNR Mon. & ced.post.	Fd. 3/8" Boat spk. & replaced	Drove 1 1/4"X22" Rod
9" R. Pine N02°W 167.3	with 1 1/4" X 18" Iron Rod	in B.Top Rd.
18" W.Pine S72°W 186.1	5" Maple N22°W 62.04	12" W. Pine N40°W 138.45
8" R.Pine N42°W 103.6	6" Maple N20°E 59.27	10" Oak N04°E 99.73
10" Oak N23°E 93.2	Fd. 1 1/2" Pipe S02°26'E 33.07	12" Oak S46°E 98.62
20" W.Pine stp. S75°W 107.3	Fd. 1 1/2" Pipe S23°27'E 100.11	6" W.Pine S24°W 33.73
	Set ced.post w/Loc Tag	Ced.post w/Loc Tag
	Due N 27.0	Due N 40.0
	Ctr. E-W B.Top Rd	
	Due S 6.0	


SIGNED BY Carl F. Roser DATE 3-31-78

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

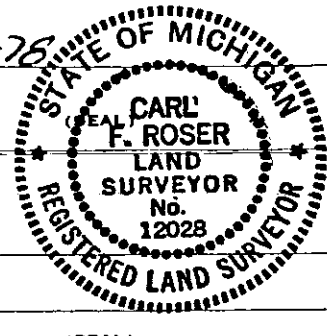

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ BLUE LAKE TOWNSHIP
 KALKASKA COUNTY