

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>28</u> ^{N.} 0. , R. <u>5</u> ^{W.} 0.	<u>J-8</u>
2. PROPERTY CONTROLLING IN SECTION <u>23</u>	T. <u>28</u> ^{N.} 0. , R. <u>5</u> ^{W.} 0.	<u>12, 14, 7</u>
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ ^{N.} 0. , R. _____ ^{E.} W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on December 2, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. Description of original monument and accessories and/or subsequent restoration.~~
C. (continued)

7

Set 5/8"x36" Re-rod W/Plastic Cap & cedar post W/Loc. Tag
 8" Twin Maple N04°E 12.4'
 4" Twin Maple S36°W 20.2'
 4" Maple S29°E 46.1'
 N-S Rand Due W 43.5'

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
 12 Set 1/8 Cor. per standard B.L.M. instructions,

J-8 Set Ctr. Sec. 23 of inter. of 1/4 lines.

14 Set 1/8 Cor. equidistant & on a line between fd. E 1/4 Cor. Sec. 23 & fd. SE Cor. Sec. 23

7 Set 1/8 Cor. equidistant & on line between fd. Sec. Cor. to N. & fd. 1/4 Cor. to South, both fd. cor's, being Schaaf Mon's.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

12

Drove 5/8"x36" re-rod W/RLS Cap & set ced. post W/Loc. Tag.
 6" Maple S75°W 17.2'
 10" Maple in Clp. S59°E 28.8'
 4" Maple in Clp. N63°W 16.4'
 Fd. 1 1/2" pipe (lot Cor) S50°34'W 19.54'

J-8

Drove 5/8"x36" re-rod W/RLS Cap & set ced. post W/Loc. Tag.
 3" Cherry S21°E 64.1'
 3" Cherry S60°W 38.3'
 3" Cherry N61°W 50.4'
 Fd. Conc. plat. Mon S58°30'W 43.84'

14

Set 5/8"x36" Re-rod W/ plastic cap & ced. post W/Loc. Tag
 4" Tri. Maple N67°W 28.7'
 8" Oak S47°E 19.9'
 9" Oak S07°E 33.2'
 N-S Rand Due W 13.3'
 N-S Trail East 310'±

SIGNED BY Carl F. Roser 2-5-78 DATE

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:


SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

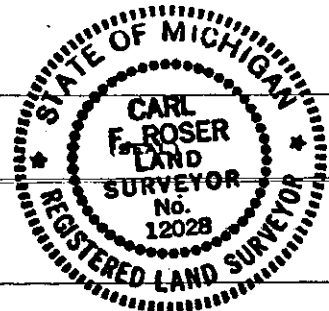

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

BLUE LAKE TOWNSHIP
KALKASKA COUNTY