

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

| FOR CORNERS OF --:                         | LOCATED IN --:   | CORNER CODE NUMBER     |
|--|--|------------------------|
| 1. PUBLIC LAND SURVEY _____                | T. <u>28</u> N. <u>0</u> R. <u>5</u> W. <u>0</u>         | B-9; <u>C-9</u> ; C-10 |
| 2. PROPERTY CONTROLLING IN SECTION _____   | T. _____ N. _____ E. _____<br>S. _____ R. _____ W. _____ | _____                  |
| 3. MISCELLANEOUS PROPERTY IN SECTION _____ | T. _____ N. _____ E. _____<br>S. _____ R. _____ W. _____ | _____                  |
| 4. LOT NO. _____, RECORDED PLAT _____      |  |                        |
| 5. PRIVATE CLAIMS _____                    |  |                        |

REGISTER OF DEEDS STAMP AND  
FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on Nov. 29, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
- B-9 Fd. and accepted 2" pipe & re-rod as fd. by J. Wilcox RLS. Corner falls in approx. ctr. of E-W dirt trail road.
  - C-9 Previous Dept. Corner of record (1968). Schaaf found and accepted corner in road intersection E-W-S in 1944; which appears to be in same position as Caukins survey describes it (1919).
  - C-10 Re-established 1/4 Cor. equi-distant & on line between Sec. Cor's. to N. & S.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

| B-9   | C-9                                 | C-10                      |
|---|-------------------------------------|---------------------------|
| Fd. 2" pipe that had been raised w/1/2"X19" rod w/RLS cap 14102 | Fd. 1 1/2" pipe raised w/1"X8" pipe | Drove 1 1/4"X18" Iron Rod |
| 10" Tw. Maple S50°W 36.9  | 9" Maple N65°W 66.4                 | 9" Maple S63°W 80.0       |
| 9" Beech S21°W 31.91  | 9" Maple S70°E 82.8                 | 6" Maple S67°E 34.2       |
| 9" Beech S38°E 37.83  | 8" Hemlock S22°E 70.1               | 6" Maple N54°E 45.9       |
| 10" Maple N44°E 18.64   | 10" Maple S43°W 50.8                | Set ced. post w/loc tag.  |
| Set Ced. post w/loc tag.  | Set ced. post w/loc tag.            | Due W 33.0                |
| Due S 33.0  | S45°E 47.0                          | Ctr. N-S gravel rd.       |
|   |                                     | Due E 5'+                 |


SIGNED BY Carl F. Roser DATE 3-31-78

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

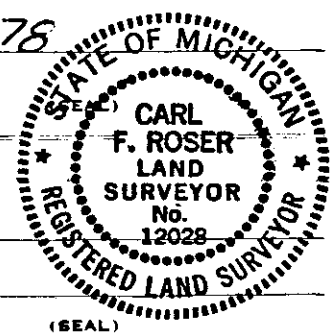

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_

BLUE LAKE TOWNSHIP  
DALKASKA COUNTY