

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>28</u> N. <u>0.</u> , R. <u>5</u> W.	<u>I-2, G-4, G-5, H-5</u>
2. PROPERTY CONTROLLING IN SECTION _____	, T. _____ N. _____ S., R. _____ E. _____ W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ N. _____ S., R. _____ E. _____ W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on October 5, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:
 C. (continued)

Fd. Dept. Mon. & cedar post
 30" R. Pine Stp. N86°W 85.7'
 24" W. Pine Stp. S08°W 26.7'
 28" W. Pine Stp. Due N 54.3'
 9" Twin Maple S07°E 117.8'
 Approx. Ctr. of curve
 of B. Top Rd. S80°W 148'±

- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
- I-2 Fd. Dept. Mon. as set in 1969 at position of found B.L. Caukins post (1919).
 - G-4 Recovered Dept. Mon. from previous Dept. Survey (1968). Said Mon. being a perpetuation of B.L. Caukin's Corner dated 1919.
 - G-5 Recovered Dept. Mon. from previous Dept. Survey (1968). Said Mon. being a perpetuation of B.L. Caukin's Corner dated 1919.
 - H-5 Recovered Dept. Mon. from previous Dept. Survey (1968). Said Mon. being a perpetuation of B.L. Caukin's Corner dated 1919.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-2	G-4	G-5
Fd. Dept. Mon & Set ced. post	Fd. Dept. Mon. & Set Ced. post	Fd. Dept. Mon,
10" Maple N24°E 189.3'	8" Maple N89°W 61.6'	ced. post & 4 large stones
8" Elm S33°W 9.0'	24" R. Pine Stp. N83°W 52.6	4" Maple N85°E 20.3
8" Elm N52°W 67.2'	12" W. Pine Stp. N39°W 64.8'	6" Triple Maple S85°W 29.1
	26" W. Pine Stp. N06°E 42.3'	8" Twin Maple S82°W 19.1

SIGNED BY Carl F. Roser 2-5-78 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:


SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

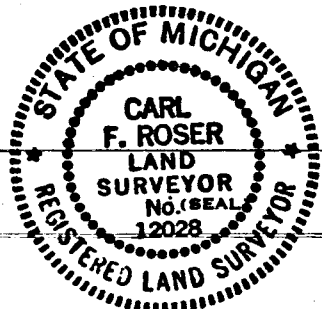

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

BLUE LAKE TOWNSHIP
KALKASKA COUNTY