EMONUMENTATION

MAR 0 3 1998

SECTION

KENT COUNTY REMONUMENTATION

1/2

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN
COUNTY OF KENT
RECEIVED FOR RECORD
97 APR 29 AM 8: 20
REG. OF DEEDS

9773

Register of Deeds Stamp & File Number

For corners in

KENT COUNTY
(County)

	Located In:	Corner Code #
1. Public Land Survey	T 5N R 9W	K-4
	T___ R___	
	T___ R___	
	T___ R___	
2. Property Controlling	S___ T___ R___	
in Section	S___ T___ R___	
3. Miscellaneous	S___ T___ R___	
Property in Sec.	S___ T___ R___	

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

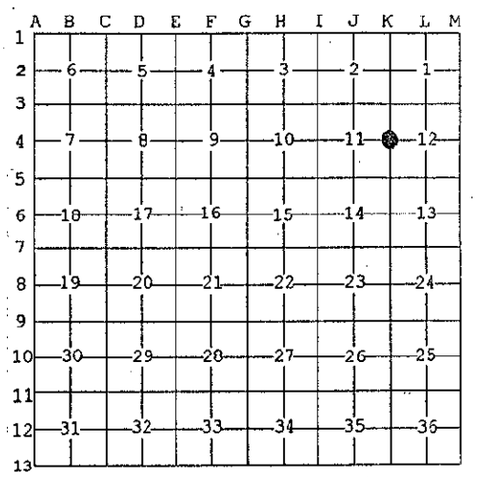

I, Kirk Breitels, in a field survey on Jan. 29, 19 97 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

K-4	1830	GLO	Mullett	Set Post
	1966	Williams & Works		Set corner on Sec. line & on line with tree row and fences
	1984	LCRC #4061	Jonker	Set Kent County Monument
	1994	LCRC #6987	Byl	Kent County Monument

The position of this corner was previously approved by the Kent County Remonumentation Peer Group, monumented by Robert J. Jonker on 12/14/84 and was recorded per LCRC #4061

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

K-4 Found standard Kent Co. Mon. (Harrison) per witnesses from above LCRC as set by Robert J. Jonker per Williams & Works information.

LCRC #4061			LCRC #6987		
Remon. tag 6" Maple	S85°E	49.64'	Nail & tag 8" Maple	S85°E	49.72'
Remon. tag 20" Walnut	N20°E	93.18'	Nail & tag 24" Maple	N20°E	93.15'
Remon. tag P. Pole	N90°W	75.04'	Nail & tag P. Pole	N90°W	74.98'
SW cor. hse. fnd.	N65°E	100.23'	SW cor. hse. fnd. (stone)	N65°E	100.23'

The selected location is accepted by me and is generally accepted by professional surveyors as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-4 Standard Kent County Monument

Nail & KC Remon. tag S. side 8" Maple	S85°E	49.72'
Nail & KC Remon. tag NW side 24" Walnut	N20°E	93.15'
Nail & KC Remon. tag S. side P. Pole	N90°W	74.98'
SW corner house foundation (stone)	N65°E	100.23'

C/L pav't. is East 2' and E-W rd. culv. is South 4'

STATE OF MICHIGAN
KIRK BREITELS
LAND SURVEYOR
MO
30077
LICENSED LAND SURVEYOR

Signed by Kirk Breitels Date 3/27/97

Surveyor's Michigan License No. 30077

P.A. 345 1990 KENT COUNTY
PEER APPROVED 3/27/97
CHAIRMAN Harry Huber

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1985