

**SURVEY & REMONUMENTATION**

MAR 03 1998

KENT COUNTY REMONUMENTATION

**SECTION**

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

KENT COUNTY

(County)

Located In:

Corner Code #

- 1. Public Land Survey T 5N R 9W L-7
- T    R
- T    R
- T    R
- 2. Property Controlling S    T    R
- In Section S    T    R
- 3. Miscellaneous S    T    R
- Property in Sec. S    T    R

- 4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
- 5. Private Claims \_\_\_\_\_

I, Kirk Breitels, in a field survey on June 5, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

REG. OF DEEDS  
*[Signature]*  
97 OCT 14 AM 10:02  
STATE OF MICHIGAN  
COUNTY OF KENT  
RECEIVED FOR RECORD

**10033**

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

**A. Description of original monument and accessories and/or subsequent restoration:**

- L-7 1830---GLO---Mullett---Set Post  
---Williams & Works---No information for this corner
- 1961---Kent Co. Wit.---3/4" Iron  
NW MBT 55.16' SE MBT 35.85' NE CP 72.75' WSW CP 95.94' F. Pole ESE 45.39'
- 1977---Survey---Consumers Power Co.---Found 3/4" Iron Pipe-raised with rebar  
T. Pole S45°E 35.81' Rd. sign N45°E 42.00'  
T. Pole N40°W 55.22' P. Pole N70°E 64.69'
- 1979---LCRC #1270---Bonnema---Found Capped Rerod  
PK in T. Pole NE 64.64' PK in T. Pole NW 54.52' NW cor. hse. SE 104.19'

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

- L-7 Found 1/2" x 24" Rerod over 1" x 24" Iron Pipe over 1/2" Iron per witnesses:  
PK in side T. Pole NE 64.66'  
C/L Stump Pole NW 55.7'  
C/L P. Pole SW 95.5'± (pole sticking out of grav. pile and leanin S'ly)
- Rerod etc. fits Meas. by Exxel and Consumers Power Co. to E-W-S


The Rerod etc. is accepted by me and is generally accepted by professional surveyors as the best available evidence of the original corner.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

- L-7 Set Standard Kent Co. Monument (Harrison) in place of the Rerod (1" Iron over Iron were moved to the side of excavation hole and remain there).
- Set Nail & KC Remon. tag S. side P. Pole N70°E 64.66'
- NE corner foundation house #14016 S55°E 110.15'
- Set Nail & KC Remon. tag E. side 15" Walnut N05°W 207.37'
- Set Nail & KC Remon. tag SW side stump pole N35°W 55.70'
- Control Monument (05-09-13) N70°W 107.21'
- On C/L extensions of asph. roads South & West
- C/L grav. rd. to North is 3'± East; C/L grav. rd. to East is 4'± North

Signed by *Kate Breitels*  
Surveyor's Michigan License No. 30077

Date 8/28/97

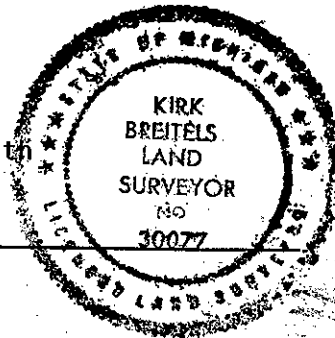

P.A. 345 1990 KENT COUNTY  
PEER APPROVED 6/26/97  
CHAIRMAN *Harry Hubell*