SURVEY & REMONUMENTATION

KENT COUNTY REMONUMENTATION

STATE OF MICHIGAR COUNTY OF KENT RECEIVED FOR RECORD

APR 27 1995

LAND CORNER RECORDATION CERTIFICATE 94 DEC -5 AM 8: 59 Filing Requirement of Act 74, Mich. P.A. 1970

-	COMMISSION
or corners	(COMMISSION

4. Lot No.

Private Claims

KENT COUNTY Located In:

Corner Code ## REG. OF DEEDS

Public Land Survey T_6N_R _11W __ R _ _ T ____ R _


7679Register of Deeds Stamp & File Number

2. Property Controlling in Section S ____ R _ S ____ R __ 3. Miscellaneous Property in Sec. S ____ T ___ R __

__ , Recorded Plat __

William R. Byl, in a field survey on ... Sent. do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

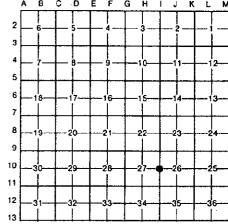

Description of original monument and accessories and/or subsequent restoration: P.A. 345 1990 KENT COUNTY

I-10	1831 1963	GLO Kent Co. Wit.	Mullett	Set Post CHAIRMAN CHAIRMAN
	1974	LCRC #741	Bonnema	Stone
	1980	LCRC #1430	Merdzinski	Set Kent County Monument
	1989	LCRC #4954	Bueche	Kent County Monument

The position of this corner was previously approved by the Kent County Remonumentation Peer Group, monumented by John A. Merdzinski on 10/16/80 and was recorded per LCRC #1430

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I-10 Found standard Kent Co. Mon. (Harrison) per witnesses from above LCRC as set by John A. Merdzinski in place of the Stone he found. Said Stone checks with Kent Co. Wit. & LCRC #741.

LCRC #1430			LCRC #4	954				
Nail & tag 24"		24.32'			side 30"		East	
Nail & tag 8" O	ak S25°W	27.70'	Nail &	tag N.	side 16"	Hickory	West	39.50'
Nail & tag 10"	Hickory West	39.50'	Nail &	tag S.	side Tw.	30" Oak	N55°W	56.40'
Nail & tag Tw.	26" Oak N55°W	56.51'	Nail &	tag E.	side 26"	Maple	NO5°E	56.63
Nail & tag 24"	Maple NO5°E	56.53'	Nail &	tag W.	side 22"	Ash	N30°W	5.68
Nail & tag 18".	Ash N30 ⁰ W	5.68	Nail &	tag E.	side 8" A	sh	S20°W	18.23

The selected location is accepted by me and is generally accepted by professional surveyors as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-10 Standard Kent County Monument

Nail & KC Remon. tag N. side 30" Beech S90°E 24.32 New Nail & KC Remon. tag N. side 16" Hickory S90°W 39.50 New Nail & KC Remon. tag S. side Tw. 30" Oak New Nail & KC Remon. tag E. side 26" Maple N55°W 57.29 NO5°E 56.58' New Nail & KC Remon. tag W. side 22" Ash N30°W 5.66' S20°W New Nail & KC Remon. tag E. side, 8" Ash

On fence N & W

Signed by . Surveyor's Michigan License No.

STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971 REVISED MAY 14, 1975 REVISED JAN., 1983

Byi

No.

23502

A

सम्बोद्धांकांकः सर्वे देखा