

MAR 08 1999

\$7.00
\$2.00

SECTION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

KENT COUNTY REMONUMENTATION

For corners in

Kent (County)	Located in:	Vergennes Township	Corner Code #
1. Public Land Survey	T <u>7N</u>	R <u>9W</u>	<u>F-8</u>
	T _____	R _____	_____
	T _____	R _____	_____
	T _____	R _____	_____
2. Property Controlling in Section	S _____	T _____	R _____
	S _____	T _____	R _____
3. Miscellaneous Property in Sec.	S _____	T _____	R _____
	S _____	T _____	R _____

REG. OF DEEDS

Lucy St. John

98 DEC 14 AM 8:00

STATE OF MICHIGAN
COUNTY OF KENT
RECEIVED FOR RECORD

10940

Register of Deeds Stamp & File Number

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

I, Randy Kolehouse, in a field survey on January 16 19 98, do hereby certify that under requirements of P.A. 74 Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

F-8 This corner was not originally set by the G.L.O.

1971	L.C.R.C. #59	Williams & Works	Set "T" Iron at Intersection of 1/4 Lines
1987	L.C.R.C. #4536	John Bueche	Fnd. Iron / Reset Iron at Intersection of 1/4 Lines

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

F-8 Found a 1/2" iron on line of a fence line running North, East, and West and a tree row running East and West per L.C.R.C. #4536 as set by John Bueche at the intersection of 1/4 lines. Found iron is 0.3' South and 0.8' East of the intersection of 1/4 lines. ("T" iron as set in L.C.R.C. #59 is S 10° W 6.17' of the 1/2" iron.) Accepted 1/2" iron as Center of Section.

L.C.R.C. #4536

- Nail & tag in NE side 10" Elm N45°W 10.06' (m. 10.07')
- Nail & tag in E side 16" Elm N10°W 21.25' (m. 21.31')
- Nail & tag in W side 26" Oak S30°E 37.95'
- Nail & tag in W side 26" Cherry S0°W 41.90' (m. 41.85')
- Cor. is on fences N-E-W, 0.2' N. of 8" dia. fence post

P.A. 345 1990 KENT COUNTY

PEER APPROVED 9/28/98


CHAIRMAN *Harry Bueche*

The selected location is accepted by me and is generally accepted by professional surveyors as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

F-8 Replaced 1/2" iron with a Standard Kent County Monument

- Nail & K.C. remon. tag on NE side 10" Elm N 45° W 10.07'
- Nail & K.C. remon. tag on E side 16" Elm N 10° W 21.31'
- Nail & K.C. remon. tag on W side 26" Oak S 30° E 37.95'
- Nail & K.C. remon. tag on W side 26" Cherry S 00° W 41.85'
- "T" iron S 10° W 6.17'
- On fence line running N-E-W
- On tree row running E-W

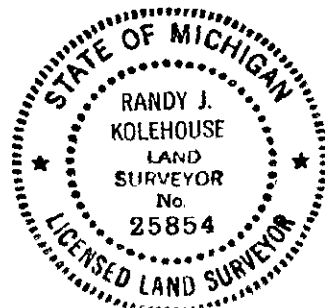

Signed by *Randy J. Kolehouse*

Date 11/18/98

Surveyor's Michigan License No. 25854

