

\$7.00
\$2.00

MAR 08 1999

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970
KENT COUNTY REMONUMENTATION

SECTION

For corners in

<u>Kent</u> (County)	Located in: Vergennes Township	Corner Code # F-10
1. Public Land Survey	T <u>7N</u> R <u>9W</u>	_____
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

STATE OF MICHIGAN
COUNTY OF KENT
RECEIVED FOR RECORDING

98 DEC 14 AM 8:00

REG. OF DEEDS

Randy Kolehuse

11023


Register of Deeds Stamp & File Number

I, Randy Kolehuse, in a field survey on September 25 19 98, do hereby certify that under requirements of P.A. 74 Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

F-10 This corner was not originally set by the G.L.O.
No information on record for this corner.

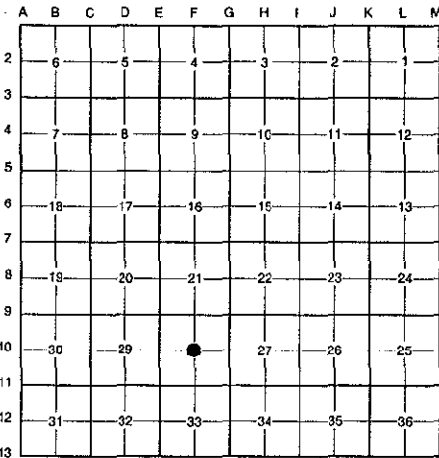

P.A. 345 1990 KENT COUNTY
PEER APPROVED 11/12/98
CHAIRMAN Randy Kolehuse

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

F-10 Found a Trueline capped rebar on line of a downed fence line running North and West and 35' North of a swamp. Capped rebar is 0.4' North and 0.4' West of the intersection of 1/4 lines. Accepted rebar as Center of Section.

The selected location is accepted by me and is generally accepted by professional surveyors as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

F-10 Replaced Capped Rebar with a Standard Kent County Monument

- Nail & K.C. remon. tag on S face 6" Maple S 68° W 2.79'
- Nail & K.C. remon. tag on W face 28" Maple S 05° E 9.05'
- Nail & K.C. remon. tag on S face 14" Oak N 85° E 21.66'
- Nail & K.C. remon. tag on W face 28" Oak N 02° W 28.28'
- On downed fence line running North



Signed by *Randy J. Kolehuse* Date 12/4/98
EARTH TECH

Surveyor's Michigan License No. 25854