

SEP 08 1999


LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970
KENT COUNTY REMONUMENTATION

STATE OF MICHIGAN
COUNTY OF KENT
RECEIVED FOR RECORD
38 OCT 23 AM 9:58
REG. OF DEEDS

10799

Register of Deeds Stamp & File Number

Form with fields for 'For corners in SECTION', 'Kent (County)', 'Located in: Vergennes Township', 'Corner Code #', and numbered items 1-5.

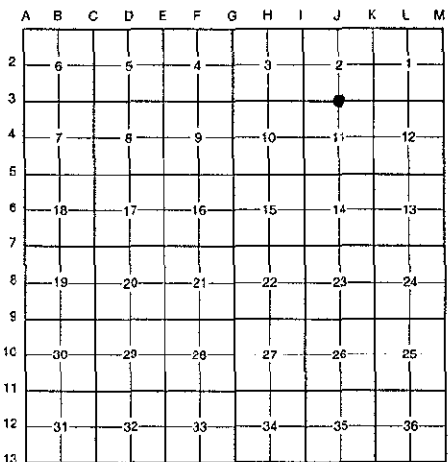

I, Randy Kolehouse, in a field survey on December 29 19 98, do hereby certify that under requirements of P.A. 74 Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Table with 4 columns: Corner Code, Date, Description, and Monument Type. Includes entries for 1838, 1904-66, 1944, 1984, and 1995.

P.A. 345 1990 KENT COUNTY
PEER APPROVED 2/19/98
CHAIRMAN [Signature]

This corner was originally approved by the Kent County Remonumentation Peer Group and monumented by Williams & Works on 8/18/84 and was recorded per L.C.R.C. #3888.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

J-3 Found a (broken) Standard Kent County Monument (.5' below grade) 2.0' North of the C/L of 3 Mile Road (bit.) running East and West on line of a fence line and tree row running North per L.C.R.C.'s #3888 and #8242 as set by Williams & Works in place of a "T" iron they found over a concrete monument which checked the 1904-66 notes of Williams & Works and the K.C. Surveyor's records.

L.C.R.C. #3888

L.C.R.C. #8242


Nail & K.C. Remon. tag in E. side 14" Ash N05 W 28.43'
Nail & K.C. Remon. tag in NE side 28" Walnut S 45 E 42.32'

Nail & KC Remon. tag E. side 18" Ash N05°W 28.35'
Nail & KC Remon. tag, NE side 32" Walnut S45°E 42.45' (m. 42.34')
Nail & KC Remon. tag N. side Tw. 18" Ash S80°W 55.33'
Nail & KC Remon. tag S. side 24" Cherry N50°W 58.82'
Nail & KC Remon. tag S. side Tw. 12" Oak N70°E 54.57'

The selected location is accepted by me and is generally accepted by professional surveyors as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- J-3 Reset a Standard Kent County Monument
Nail & K.C. remon. tag on E side 18" Ash N 05° W 28.35'
Nail & K.C. remon. tag on NE side 32" Walnut S 45° E 42.34'
Nail & K.C. remon. tag on N side twin 18" Ash S 60° W 55.33'
Nail & K.C. remon. tag on S side 24" Cherry N 50° W 58.82'
Nail & K.C. remon. tag on S side twin 12" Oak N 70° E 54.57'
C/L bit. road running E-W, South 2.0'±
On fence line and tree row running N

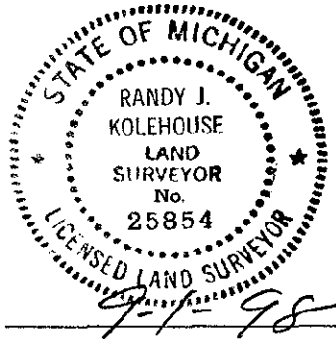

Signed by [Signature] Date 9-1-98

Surveyor's Michigan License No. 25854