

JAN 24 1996

KENT COUNTY REMONUMENTATION

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
KENT COUNTY
(County)

Located In:

Corner Code #

1. Public Land Survey	T	<u>7N</u>	R	<u>12W</u>	<u>H-4</u>
	T		R		
	T		R		
	T		R		
2. Property Controlling in Section	S		R		
	S		R		
3. Miscellaneous Property in Section	S		R		
	S		R		

STATE OF MICHIGAN
COUNTY OF KENT
RECEIVED FOR RECORD
95 DEC 26 PM 12:42
REG. OF DEEDS
8844
Register of Deeds Stamp & File Number

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	16	17	18	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Kirk Breitels, in a field survey on Nov. 15, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- H-4 1837 GLO Not Set 1941-60 Williams & Works Concrete Monument
- 1960 Kent Co. Wit. Concrete Monument
- MBT N. 20.85' 13" Tw. Box Elder SW 28.09' 18" Oak SSE 25.0'
- 1971 LCRC #64 Chambers Set 3/4" Iron from 1960 Wits.
- 18" Oak S20°E 25.00' 36" Ash N85°W 121.22' Cor. F.P. N. 20.41'
- 1974 LCRC #628 South 3/4" Rod
- 20" Oak SSE 25.28' F.P. N. 20.52' 30" Oak WNW 122.78' P.P. WSW 138.96'
- 1977-80 Exxel Eng. RR Spike
- 1992 LCRC's #6201 & #6548 Herrema RR Spike (see witnesses reverse side)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

H-4 Found RR Spike that fits remaining witnesses of those above. Said RR Spike is 0.8' S. & 1.0' E. from true intersection of 1/4 lines and fits measurements of others.

The RR Spike is accepted by me and is generally accepted by professional surveyors as the best available evidence of the position of the corner.


P.A. 345 1990 KENT COUNTY

PEER APPROVED 11/17/94

CHAIRMAN [Signature]

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- H-4 Set Standard Kent County Monument in place of the RR Spike
- Set Nail & KC Remon. tag SW side Guy Pole N50°E 48.59'
- Set Nail & KC Remon. tag SW side P. Pole N70°E 93.85'
- SW cor. catch basin header S70°E 49.87'
- C/L manhole S50°E 13.15'
- Set Nail & KC Remon. tag N. side P. Pole S70°W 139.34'
- Face of hydrant at grade N75°W 152.90'

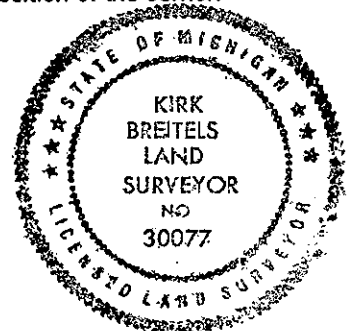

Signed by [Signature]

Date 12/14/95

Surveyor's Michigan License No. 30077