

KENT COUNTY REMONUMENTATION

KENT COUNTY REMONUMENTATION

\$7.00
\$2.00

JAN 24 1996

COMMISSION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
KENT COUNTY
(County)

Located in:

Corner Code #

1. Public Land Survey	T	8N	R	12W	D-10
	T		R		
	T		R		
	T		R		
2. Property Controlling in Section	S		T		R
	S		T		R
3. Miscellaneous Property in Section	S		T		R
	S		T		R

REG. OF DEEDS

Lucy Spauld

95 DEC 20 AM 8:38

STATE OF MICHIGAN
COUNTY OF KENT
RECEIVED FOR RECORD

8790

Register of Deeds Stamp & File Number

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	6	5	4	3	2	1					
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Kirk Breitels, in a field survey on April 4, 1995, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- D-10 1837 GLO Not Set
- 1941-48 Williams & Works Conc. Mon. Kent Co. Wit. Conc. Mon.
- 1972 LCRC #454 VanKooten Conc. Mon. 24" Apple ENE 44.80'; 14" Apple NW 66.17'; P. Pole W 75.73'
- 1993 Research Exxel Used per LCRC #454

P.A. 345 1990 KENT COUNTY

PEER APPROVED 9/28/95

CHAIRMAN *Harry Huber*


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

D-10 Found Rerod driven inside the Iron Pipe of a Conc. Mon. (12" below road) per witnesses of those above. Said Rerod-Conc. Mon. is 0.1' W. & 4.9' S. of intersection of 1/4 lines.

The Rerod-Conc. Mon. is accepted by me and is generally accepted by professional surveyors as the best available evidence of the position of the corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- D-10 Set Standard Kent County Monument in place of the Rerod over top of Conc. Monument
- Chiseled "X" top of conc. culv. S40°E 22.74'
- Set Nail & KC Remon. tag N. side P. Pole N85°W 75.78'
- Set Nail & KC Remon. tag E. side 20" Apple N25°W 97.80'
- Set Nail & KC Remon. tag W. side 24" Apple N35°E 68.71'
- Set Nail & KC Remon. tag N. side 24" Apple N65°E 44.80'

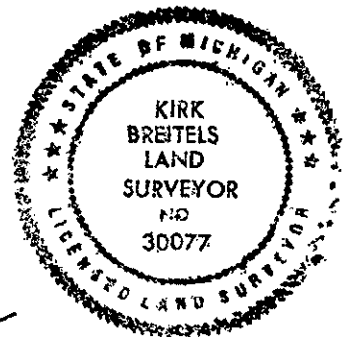

Signed by *Kirk Breitels*
30077

Date 12/6/95

Surveyor's Michigan License No. _____