1	SURVEY A	
	REWONLAND	10M
14 14 15		17

For corners in

KENT COUNTY

3. Miscellaneous

Property in Sec.

(County)

MAR 08 1999

## KENT COUNTY REMONUMENTATION

	LAND CORNER RECORDATION CERTIFICATE
ECTION	Filing Requirement of Act 74, Mich. P.A. 1970

SIC	MOIT
Car can	H H 18-20 3 /

Corner Code #

•			
1. Public Land Survey		T <u>9N R12W</u>	M-8
		TR	common with
	:	TON RIIW	A-8
2. Property Controlling	S	K	<del></del>
in Section	<u>s</u> —		


Located In:

10502Register of Deeds Stamp & File Number

		•
4. Lot No	, Recorded Plat	
5 Private Cla		

Kirk Breitels , 19 <sup>98</sup> in a field survey on . Jan. 5 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

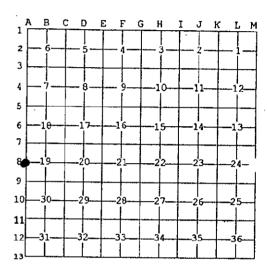

A. Description of original monument and accessories and/or subsequent restoration;

M-8	1837 1935	GLO Kent Co. Wits	Brookfield	Set Post Concrete Monument
		LCRC #4023 LCRC #8335	Rosema Breitels	Set Kent County Monument Kent County Monument

P.A. 345 1990 KENT GOUN PEER APPROVED 2/19 CHAIRMAN

The position of this corner was previously approved by the Kent County Remonumentation Peer Group, monumented by Maurice J. Rosema on 11-20-84 and was recorded per LCRC#4023.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

M-8 Found Kent County Monument (Harrison) per witnesses from above LCRC as set by Maurice j. Rosema over top of the Concrete Monument he found. Said Concrete Monument checks with Kent Co. Wits.

LCRC #4023

LCRC #8335

Nail & Remon. tag 12" Maple

S06°E 379.43'

Nail & Remon, tag 14" Cherry

N77°E 50.15'

Nail & Remon. tag 8" Elm

N05°E 274.80'

Nail & Remon. tag clump 16" Oaks

S90°E 39.22'

Nail & Remon. tag 10" Cherry

N77°E 50.20'

Nail & Remon. tag clump 12" Maples N20°E 129.27

Nail & Remon. tag clump 12" Oak S90°E 39.15'

C/L of N-S b.t. road - West 1'

1" Iron - East - 32.67'

"The selected location is accepted by me and is generally accepted by professional surveyors as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner

M-8 Standard Kent County Monument

Nail & KC Remon. tag NW side 14" Cherry Nail & KC Remon. tag S. side clump 16" Oaks

N77°E 50.15 SOUSE 39.221

Nail & KC Remon. tag W. side clump 12" Maples

N20°E 129.27

Nail & KC Remon. tag NW side 4" Maple

N60°E 38.59

1" Iron - East - 32.67'

Centerline of N-S blacktop road is West 1'

BREITELS LAND SURVEYOR 30077 LAND

KIRK

Date	2/19/98

Signed by