	SURVEY S. REMONUMENTATION
1/2	

For corners in

KENT COUNTY

MAK	(I, I)	C)	1999	

SECTION

KENT COUNTY REMONUMENTATION

LAND Filin

O CORNER RECORDATION CERTIFICATION CERTIFICA	REG. O	- L30 8	SECEIVED STRUCK
Corner Code #	FDEED	7 (4)	
C-10	SS	0: 15	OF THE

1. Public Land Survey 2. Property Controlling in Section 3. Miscellaneous Property in Sec.


Located In:

10702Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat 5. Private Claims

Kirk Breitels in a field survey on July 13 , $19\underline{98}$ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below;

NOTE: Not more than 2 comers, all in the same town and range, may be recorded on this certificate.

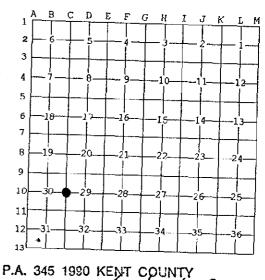

A. Description of original monument and accessories and/or subsequent restoration:

	GLO Kent Co. Wits LCRC #2483 LCRC #2949 LCRC #6141	Whitcomb Glaza Merdzinski Byl	Set Post Conc. Mon. Iron in Mon. Box Set Kent County Monument in Mon. Kent County Monument in Mon.	P.A. 345 1990 KENT COUNTY PEER APPROVED 9/24/98 CHAIRMAN Formy fur Box
1991	LCRC #6141	Byl	Kent County Monument in Mon. Box	S ,

The position of this corner was previously approved by the Kent County Remonumentation Peer Group, monumented by John A. Merdzinski on 6-28-82 and was recorded per LCRC #2949.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

C-10 Found Kent County Monument (Harrison) per witnesses from above LCRC as set by John A. Merdzinski in place of the 10" long Iron he found inside a Mon. Box over a Conc. Mon.. Both check with Kent Co. Wits. and LCRC #2483.

LCRC #6141 Nail & Remon. tag 14" Elm S88°W 37.82' Nail & Remon. tag 22" Elm S88°W 38.12' NE corner frame bldg. S50°W 127.75' Nail & Remon. tag 10"Apple S45°E 74.64" C/L 6" Apple S45°E 74.80' Nail & Remon. tag 8" Apple "N40°E 69.50" C/L 6" Apple N40°E 69.30' S. end 12" steel culvert N45°E 38.70' S. end 12" steel culv. N45°E 38.70' Nail & Remon. 10" Pine S45°W 77.05'

The selected location is accepted by me and is generally accepted by professional surveyors as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-10 Standard Kent County Monument

Nail & KC Remon. tag N. side 24" Elm S88°W 38.12' Nail & KC Remon. tag NE side 12" Apple S45°E 74.64' Nail & KC Remon. tag NW side 10" Apple N40°E 69.531 Nail & KC Remon. tag NE side 4" Apple N25°W 105.32' C/L N-S pavement is West 1.5' ±

OF MICH

Signed by

Surveyor's Michigan License No._

30077