\$7	00
07	00
- P	

MAR 08 1999

KENT COUNTY REMONUMENTATION

per perial period or just the	3 41 1 20
	ON
- Can - N - 2 8 8	186

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in KENT COUNTY

Located In: Corner Code # (County) 1. Public Land Survey 2. Property Controlling in Section 3. Miscellaneous Property in Sec.


10475

Register of Deeds Stamp & File Number

, Recorded Plat 4. Lot No. 5. Private Claims

Kirk Breitels Jan. 6 19 <sup>98</sup> in a field survey on do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

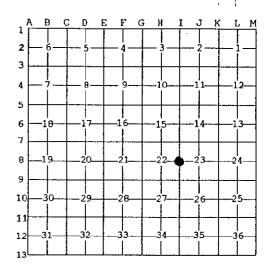

A. Description of original monument and accessories and/or subsequent restoration:

I-8	:1837	GLO	Whitcomb	Set Post
	1 <b>971</b>	Kent Co. Wits		Mon. Box
	1971	LCRC #982	Bonnema	Iron in Mon. Box

1982 LCRC #2939 Merdzinski Set Kent County Monument in Mon. Box

1995 LCRC #8303 Breitels Kent County Monument P.A. 345 1990 KENT COUNTY

The position of this corner was previously approved by the Kent County Remonumentation Peer Group, monumented by on and was recorded per LCRC #.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I-8 Found Kent County Monument (Harrison) per witnesses from above LCRC as set by John A. Merdzinski in place of the 1" Iron he found inside a Mon. Box . Said Iron checks with Kent Co, Wits. and LCRC #982.

LCRC #2939			LCRC #8303		
SW corner brick building	S45°E	67.031	SW corner brick building	S45°E	67.03'
NW corner brick building	S65°E	50.30'	NW corner brick building	S65°E	50.30'
NE corner brick building	N60°W	102.50'	NE corner brick building	N60°W	102.50'
NE corner brick building	S70°W	99.11'	NE corner brick building	S70°W	99.11'
Nail & Remon. tag P. Pole	S85°E	32.10'	Nail & Remon. tag P. Pole	S85°E	31.92'

The selected location is accepted by me and is generally accepted by professional surveyors as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-8 Standard Kent County Monument

SW corner brick building	S45°E	67.03'
NW corner brick building	S65°E	50.30*
NE corner brick building	N60°W	102.50
NE corner brick building	S70°W	99.11'
Nail & KC Remon. tag S. side P. Pole	S85°E	32.02

OF MICH KIRK BREITELS LAND SURVEYOR NO 3007 SE0

Surveyor's Michigan License No.