

\$7.00  
\$2.00

QUINCY &  
ASSOCIATES

MAY 22 2000

### KENT COUNTY REMONUMENTATION

SECTION

### LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN  
COUNTY OF KENT  
RECEIVED FOR RECORD  
1999 DEC 15 AM 8:55  
REG. OF DEEDS

For corners in

KENT COUNTY (County)	Located In:	Corner Code #
1. Public Land Survey	T 10NR 11W	F-10
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

11590

Register of Deeds Stamp & File Number

- 4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
- 5. Private Claims \_\_\_\_\_

I, Kirk Breitels, in a field survey on Aug. 12, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

F-10 1837	GLO	Not Set
	Williams & Works	No information
	Kent Co. Wits	No information
1995	Survey Hackbardt	1/2" Rebar
	20" Oak N60°E 35.07 12" Maple N85°W 63.64' C.P. S35°E 64.60'	

P.A. 345 1990 KENT COUNTY  
PEER APPROVED 8/26/99  
CHAIRMAN Harry Huber


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:  
F-10 Found Capped Rerod (Hackbardt) per above witnesses that is 0.1' W. & 0.9' N. from intersection of 1/4 lines

Also found RR Spike: 0.1' E. & and less than 0.1' S. from intersection of 1/4 lines  
Also found "MAG" Nail: 0.7' E. & and less than 0.1' N. from intersection of 1/4 lines  
All measurements by other surveyors agree with the Intersection of 1/4 lines ±.

The Intersection of 1/4 lines is accepted by me and is generally accepted by professional surveyors as the best available evidence of the position of the corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- F-10 Set Standard Kent County Monument in Mon. Box at the Intersection of 1/4 lines
- Nail & KC Remon. tag S. side P. Pole N60°E 57.08'
- Nail & KC Remon. tag NE side P. Pole S35°E 63.88'
- Nail & KC Remon. tag E. side T. Pole S20°W 45.52'
- Nail & KC Remon. tag E. side 10" Oak S40°W 56.11'
- Nail & KC Remon. tag S. side 48" Oak N50°W 19.88'
- Monument is on N. side of E-W asphalt road.

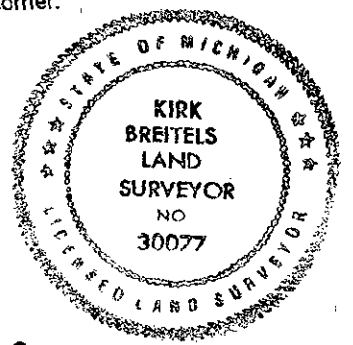

Signed by Kirk Breitels  
Surveyor's Michigan License No. 30077

Date 12/6/99