

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN
 COUNTY OF KENT
 RECEIVED FOR RECORD
 93 AUG 24 PM 2:55

For corners in

<u>Kent</u> (County)	Located In:	Corner Code =#
1. Public Land Survey	T <u>10N</u> R <u>11W</u>	<u>J-3</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

W. E. Glaza
 REG. OF DEEDS
 6810
 Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Wallace E. Glaza, in a field survey on August 12, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
 Original government note - corner in lake.

LCRC No. 4548 (Hackbardt) - set 1/2" rebar on North-South 1/4 Line for Section 11 and at 100' S0°57'19"E from J-3 location.

- 14" Maple N85°W 7.92'
- 4" Birch S5°W 22.3'
- 4" Ash S25°E 18.5'


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

J-3 (North 1/4 corner, Section 11, T10N, R11W, Solon Township, Kent County, Michigan)

Found rebar as per LCRC No. 4548. Agreed with location of Hackbardt's computed corner North and South, but not East and West. Established computed North 1/4 corner equal distance from NW corner of Section 11 and NE corner of Section 11 and held old fence lines on West and East sides of lake for North-South alignment.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- See LCRC No. 6807 for North witness monument.
- See LCRC No. 6809 for East witness monument.
- See LCRC No. 6808 for South witness monument.
- See LCRC No. 6806 for West witness monument.

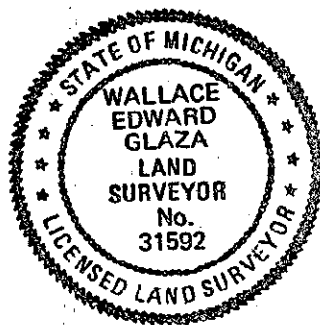

Signed by Wallace E. Glaza
 Glaza and Associates, Inc. 31592
 Surveyor's Michigan License No. _____

Date 8-17-93