JAY 88 7030

KENT COUNTY REMONUMENTATION

SECTION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

•	TER LINE OF THE TOTAL	
For corners in		
KENT COUNTY	Located In: C	orner Code#
(County)		Tyrone Twp.
1 Public Land Surve	T 10N R 12W	E-10

1. Public Land Survey	· <u></u>	
(, Public Land Carry)	TR	
	TR	
	TR	
2. Property Controlling	s	
2. Property Condomina	s	
in Section	s TR	
3. Miscellaneous	S TR	
Property in Sec.		




11151

Register of Deeds Stamp & File Number

Lot No	, Recorded Plat
. Private Claims	

Kirk Breitels in a field survey on Jan. 25 19 99 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the line of th United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or United States Department of the Interior, bureau or Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 comers, all in the same town and range, may be recorded on this certificate.

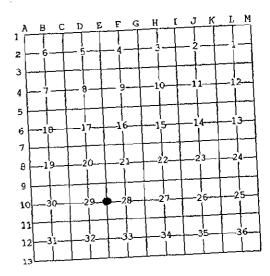

A. Description of original monument and accessories and/or subsequent restoration:

Description of original monument and accessories and/or subsequent restoration.				P.A. 345 1990 KENT COUNTY,
E-10 1837 1971 1973 1982	GLO Kent Co. Wits LCRC #463 LCRC #2711 LCRC #7577	Whitcomb Spicer Jonker	Set Post Boat Spike Boat Spike Set Kent County Monument in Mon Kent County Monument	CHAIRMAN Tany fuller

The position of this corner was previously approved by the Kent County Remonumentation Peer Group, monumented by Robert J. Jonker on 3-10-82 and was recorded per LCRC #2711.

Description of corner evidence found and/or method applied in restoring or reestablishing corner:

E-10 Found Kent County Monument (Harrison) per witnesses from above LCRC as set by Robert J. Jonker in place of the 1/2" Iron he found inside a Mon. Box. Said Iron checks with LCRC #463 and Kent Co. Wit.

S70°E 27.49' Nail & Remon. tag P. Pole LCRC #2711 S70°E 27.45' S10°E 128.44' Nail & Remon. tag P. Pole Nail & Remon. tag 34" Maple Nail & Remon. tag 34" Maple S10°E 128.44' Nail & Remon. tag 18" Tw. Maple N25°W 122.76' N90°W 68.36' Nail & Remon, tag 8" Birch Nail & Remon. tag 10" Maple S70°W 121.51' Nail & Remon. tag in guard post N30°W 50.53' C/L E-W pole line is 8' S.

C/L pavement is East 3' m/l C/L pavement is East 3' m/l

The selected location is accepted by me and is generally accepted by professional surveyors as the best available

evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.

E-10 Standard Kent County Monument in Mon. Box S70°E 27.45 Nail & KC Remon. tag N. side P. Pole S10°E 128.41' Nail & KC Remon. tag W. side 36" Maple N25°W 122.76' Nail & KC Remon, tag NE side 18" Twin Maple S70°W 121.47' Nail & KC Remon. tag N. side 12" Maple C/L E-W pole line is 8' South C/L pavement is East 3' ±

MED LAND

DF MICH

KIRK

RREITELS

LAND

SURVEYOR

3007

Signed by

Surveyor's Michigan License No.