

ESTABLISH & MONUMENTATION

KENT COUNTY REMONUMENTATION

JAN 24 1996

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
KENT COUNTY
(County)

Located In:

Corner Code #

- 1. Public Land Survey T 10N R 12W F-10
- T R
- T R
- T R
- 2. Property Controlling S T R
- in Section S T R
- 3. Miscellaneous S T R
- Property in Section S T R

STATE OF MICHIGAN
COUNTY OF KENT
RECEIVED FOR RECORD

95 NOV 14 AM 10:22

REG. OF DEEDS

Lucy Bond

8747

Register of Deeds Stamp & File Number

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2							
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Kirk Breitels, in a field survey on Oct. 24, 1995
do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- F-10 1837 GLO Not Set
- 1915 Williams & Works Found Stake
- 1974 Kent Co. Wits "T" Iron
CP W 40.71' CP NE 55.51' SW cor. hse. SE 93.28'
- 1980 Survey By1 Set Capped Rerod at intersection of 1/4 lines
- 1982 Survey Williams & Works Ran N-S 1/4 line between 1/4 corners

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


F-10 Found Capped Rerod (By1) less than 0.2' N. & less than 0.1' E. of intersection of 1/4 lines. Did not find the "T" Iron per Kent Co. Wits nor do any witnesses remain nor do the witnesses make any sense for this location (witnesses and Iron for another corner?).

The Capped Rerod (By1) is accepted by me and is generally accepted by professional surveyors as the best available evidence of the position of the corner.

P.A. 345 1990 KENT COUNTY
PEER APPROVED 10/26/95
CHAIRMAN *Henry Kuber*

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- F-10 Set Standard Kent County Monument in place of Capped Rerod (By1)
- Set Nail & KC Remon. tag E. side cluster 10" Maple N05°W 53.11'
- Set Nail & KC Remon. tag S. side P. Pole S80°E 38.87'
- Set Nail & KC Remon. tag SW sode Tw. 12" Elm S40°E 81.38'
- Set Nail & KC Remon. tag SE side 15" Cherry S30°W 103.06'
- Remains of N-S fence is 6' West ±
- E-W power lines are 8' South ±

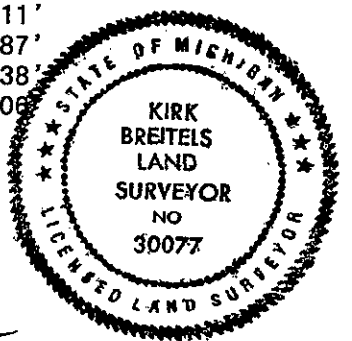

Signed by *Kirk Breitels*
30077

Date 11/8/95

Surveyor's Michigan License No. _____