

SECTION

## KENT COUNTY REMONUMENTATION

## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

Filli	ng Requirement of Act 74
Located In:	Corner Code #
T10N D	Tyrone Twp.
TR TR TR	
S T R S T R	
S TR S TR	
	Located In:  T10N R T R T R T R S T R S T R

STATE OF MICHIGAN
COUNTY OF KENT
RECEIVED FOR RECORD
999 MAR 24 AN 8: 02


11175

Register of Deeds Stamp & File Number

	Lot No , R Private Claims	Recorded Plat	<del></del>	······································	·
١,	Kirk Breitels	, in a field survey on	Jan. 26	_, 19 <sup>99</sup>	do hereby state that unde
CC	nformance with regulation	flichigan P.A. of 1970, the corne ns and rules therefore as require of the Interior, Bureau of Land M	d in the curre	nt manual	of survey instructions of th

United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

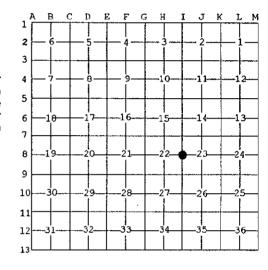

A. Description of original monument and accessories and/or subsequent restoration:

I-8	1837 1983 1984	GLO Kent Co. Wits LCRC #3702 LCRC #3884	Whitcomb  Hay  Kolehouse	Set Post Iron & Stone Iron Set Kent County Monument
	1991	LCRC #6009	Byl	Kent County Monument

P.A. 345 1990 KENT COUNTY
PEER APPROVED 2/25/99
CHAIRMAN Thule

The position of this corner was previously approved by the Kent County Remonumentation Peer Group, monumented by Randy J. Kolehouse on 8-11-84 and was recorded per LCRC #3884.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I-8 Found Kent County Monument (Harrison) per witnesses from above LCRC as set by Randy J. Kolehouse in place of the 3/4" Ironin top of a 1" Iron he found. Both Irons check with Kent Co. Wits. and LCRC #3702.

LCRC #3884 LCRC #6009 Nail & Remon. tag 18" Ash N10°E 17.04' Nail & Remon. tag 24" Ash N10°E 17.00' Nail & Remon. tag 12" Ash Nail & Remon, tag 10" Ash N30°W 12.80' N30°W 12.70' Nail & Remon. tag Tw. 8" Birch S45°W 17.15' Nail & Remon. tag Tw. 8" Birch S45°W 17.27' Nail & Remon. tag fence post South 5.2' Nail & Remon. tag fence post S00°W 5.39' Nail & Remon. tag Nail & Remon. tag 8" Birch S25°E 26.47'

The selected location is accepted by me and is generally accepted by professional surveyors as the best available evidence of the position of the original corner

evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

1-8 Standard Kent County Monument

 Nail & KC Remon. tag W. side 27" Ash
 N10°E
 16.97'

 Nail & KC Remon. tag E. side 15" Ash
 N30°W
 12.60'

 Nail & KC Remon. tag N. side Tw. 10" Birch
 S45°W
 17.27'

 Nail & KC Remon. tag NE side 10" Birch
 S25°E
 26.47'

KIRK
BREITELS
LAND
SURVEYOR
NO
30077

Signed by	Kuh	Phuls
- •	chigan License No.	30077

Date 2/25/99