

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Keweenaw County Located in: Corner Code #

- | | | | |
|------------------------------------|---|-----------|-------|
| 1. Public Land Survey | | T56N R30W | E-6 |
| | | T56N R30W | E-7 ✓ |
| | | T R | |
| | | T R | |
| 2. Property Controlling in Section | S | T R | |
| | S | T R | |
| 3. Miscellaneous Property in Sec. | S | T R | |
| | S | T R | |

4. Lot No. , Recorded Plat
 5. Private Claims

FEB 07 2001

SECTION

I, Steven C. Hein, in a field survey on May 26, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- E-6: W1/4 Corner Section 16: From original notes: South true line between Sections 16 & 17: 40.00 Set post quarter Section corner; Fir 8 S70W 23; W. Birch 6 N37E 22. No evidence of original corner or accessories found.
- E-7: SW. Corner Section 16: From original notes: South true line between Sections 16 & 17: 80.00 Set post Corner of Sections 17, 20, 16 & 21; Fir 6 S50W 16; W. Birch 8 N30E 17. No evidence of original corner or accessories found. C & H record for corner is a square W. Birch, not found.


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- E-6: W1/4 Corner Section 16: Set corner at proportionate distance between found Northwest and Southwest corners. Position falls near tree marked with paint for approximate quarter corner.
- E-7: SW. Corner Section 16: Found hub and tack with angle iron post marker, as per R. S. Haataja record provided in research. No other evidence found. Accepted above as best available position for corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- | | |
|---|--|
| E-6: W1/4 Corner Section 16:
Set 4" Brass Cap stamped for corner
On 1" pipe, in rock mound
Witnesses:
15" W. Birch N88°E 36.80'
10" W. Birch S26°E 48.80'
7" Balsam S54°W 40.03'
13" W. Birch N09°W 31.11' | E-7: SW. Corner Section 16:
Replaced hub with 4" Brass Cap stamped for corner
on 1" pipe, 61' East to Lake, 12' So. & 9' E. to Bank
Witnesses:
7" Balsam N02°E 4.24'
7" Balsam S35°W 7.59'
8" Balsam N76°W 33.42'
15" W. Birch N24°W 24.49' |
|---|--|

Bearings are compass bearings, corrected for declination, all distances are to a nail and tag in the side of the witness object unless otherwise noted.

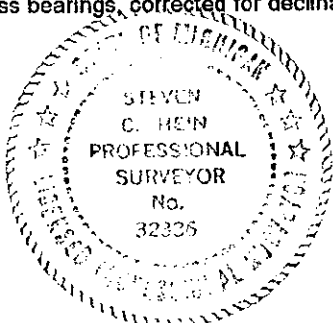

REGISTER'S OFFICE } SS
 County of Keweenaw }
 Received for Record, the 25th
 day of October A.D. 2000
 at 11:00 o'clock A. M., and Recorded
 in Liber 2 of LCR
 on page 1
Marilyn Weingart
 Register of Deeds

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

Ratified by Peer Group
 In accordance with P.A. 345
 Co. Rep. *James M. Hubbell*
 Date 10/24/00

Signed by Steven C. Hein

Date OCTOBER 21, 2000

Surveyor's Michigan License No. 32336