



INGERSOLL, WATSON & LANDCOR-Kalamazoo

LC-000100

Page: 1 of 1

12/28/1999 03:51P
Bk-2 Pg-553

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in RICHLAND TOWNSHIP
KALAMAZOO

(County)

Located In:

Corner Code #

1. Public Land Survey

T 1S. R 10W.

E-13

T	_____	R	_____
T	_____	R	_____
T	_____	R	_____
T	_____	R	_____
S	_____	T	_____
S	_____	T	_____
S	_____	T	_____
S	_____	T	_____

2. Property Controlling in Section

3. Miscellaneous Property in Sec.

SURVEY & REMONUMENTATION

FEB 08 2000

SECTION

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

6. IWM Job No. 32282

I, Allen H. McMachen, in a field survey on November, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M	
1														
2	6			5			4			3			2	1
3														
4	7			8			9			10			11	12
5														
6	18			17			16			15			14	13
7														
8	19			20			21			22			23	24
9														
10	30			29			28			27			26	25
11														
12	31			32			33			34			35	36
13														

A. Description of original monument and accessories and/or subsequent restoration:

1827 - John Mullett, D.S., Set post corner to Secs. 32 & 33, Wh. Oak 9" N. 68° E. 57 lks., Wh. Oak 18" N. 75° W. 33 lks.

1874 - Ed Strong, C.S., "Hickory 8" N. 32° E. 85 lks., Stone - from remains & jog"

1887 - F. Hodgman, C.S., Corner set on former survey, found long stone S. 30 1/2° W. 87 lks. from Hick bearing tree of resurvey. Left stone in place and put post top of it, Wh. Oak 12" S. 61 1/2° E. 63 lks..

1981 - Ingersoll, Watson & McMachen, Inc., Set mon. box

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


Found IWM iron in mon. box. Removed iron and mon. box and found a domed stone 2' below grade directly under surface marker. Dug around edges of stone 12" and found stone still going down.

RATIFIED
BY KALAMAZOO COUNTY
REMONUMENTATION
PEER GROUP
11-18-1999

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Top of domed stone is accepted as the best available evidence of the position of the original corner. Placed a 20" Harrison Monument over high point of domed stone with monument box over, Accessories:

- Nail & tab in East side of U. pole N. 15° W. 50.37'
- Nail & tab in East side of U. pole S. 25° W. 34.35'
- Nail & tab in S'ly side of 16" Maple S. 55° E. 105.03'
- Top of hydrant N. 50° E. 49.17'
- 4.5' West of centerline road to North
- 2' South of East and West road

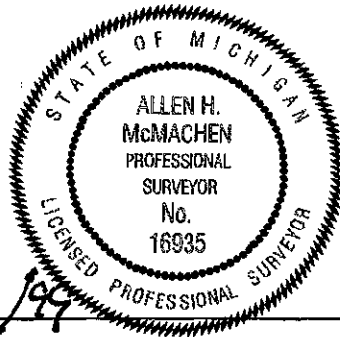

Signed by Allen H. McMachen
Surveyor's Michigan License No. 16935

Date 12/28/99