1	MAY	28	1997
,			0.00

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in	J	1
K <u>alamazoo</u>	Located In:	Corner Code #
Richland 1. Public Land Survey	T <u>1S</u> R <u>10</u> TR_	
Property Controlling in Section Miscellaneous Property in Sec.	TR_ TR S TR S TR S TR_ S TR	


RECEIVED FOR RECORD KALAMAZOC

Register of Deeds Stamp & File Number LIBER 2PAGE 052

4. Lot No,	Recorded Plat	
5. Private Claims		

Robert E. Snell , in a field survey on April 30, 19 96 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Sureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

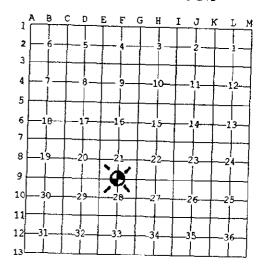

A. Description of original monument and accessories and/or subsequent restoration: 1826: United States Government surveyors; set ‡ section post.

Wh. Oak 30" South 14 1ks.

Y. Oak 14"

N 2° W

38 lks.

1887: F. Hodgman, County Surveyor; found stake and stone and stump of bearing tree NW all in place. Set post.

Wh. Oak 8"

S 66° W

Wh. Oak 8"

N 57° E

9½ 1ks. 24 1ks.

Description of corner evidence found and/or method applied in restoring or reestablishing corner.

Wilkins and Wheaton Engr. Co.; found tile in line with North and South fence. Fence to North 1.1'.

12" Hickory 12" Hickory

East

12.901

N 45° E

5.551

12" Hickory

S 85° W

18.15

1996: Found tile at surface of ground.

RATIFIED BY KALAMAZOO COUN REMONUMENTATION PEER GROUP 7-18-1996

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
F-09: South ½ post Section 21, T 1 S, R 10 W; ratified by the Kalamazoo County Remonumentation Program Peer Group on July 18, 1996 and is accepted as a careful and faithful perpetuation of the position of the original corner. Found 3" round tile as set by F. Hodgman, County Surveyor in 1887 remonumentation survey. Placed remonumentation sleeve

PK nail on North side 14" Cherry N 85° W 8.501 PK nail on West side 16" Hickory N 45° E 5.401 PK nail on North side 8" Hickory S 409 W 7.401 PK nail on West side 14" Oak North 37.25

Signed by Surveyor's Michigan License No.