APR 0 1 1996

COMMISSION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN
COUNTY OF KALAMAZOG
RECEIVED FOR
RECEIVED FOR RECORD

'95 DEC 14 PM 3 30

Cooper Townsh	_{ip} Filing Kequire	ement of Act 74, Mich. P.A	1970	~ ;	111 0 36	J
For corners in Kalamazoo	Located In:	Corner Code #	\cap			
(County)		·	San	ncal	GISTER	/
Public Land Survey	T <u>1S.</u> R <u>11W.</u> T R T R		CLE			
Property Controlling in Section	S T R S T R		LIBER	1	1410	
3. Miscellaneous	S T R				•	
Property in Section	S T R		Register of Deed	s Stam	p & File Num	ber
4. Lot No, Re	corded Plat		A B C	D E i	FG H J	KLI
5. Private Claims						
6. IWM Job No. 24971			3 4 7	89	1011	112
do hereby certify that under require lines 1 and 2 above were in commanual of survey instructions. Management or by a decree of a 5 above were in conformance we Decree of a Court of Law; estable	irements of P.A. 74, Michigan P., Informance with regulations and It of the United States Departm Court of Law and/or that the co- It the rules of the Michigan Bo- It is the rules of the Rules of the Michigan Bo- It is the rules of the Rules of the Michigan Bo- It is the rules of the Rules of the Michigan Bo- It is the Rules of th	, 19 95 A. of 1970, the corner points mentiouses therefore as required in the current of the Interior, Bureau of primer points mentioned in lines 3, 4 pard of Professional Surveyors or ted, re-monumented, recovered, for	oned 6 18 18 18 19 19 19 19 19 19 19 19 19 19 19 19 19	171	12223	3 - 24 - 6 - 25
as expressed below:			11	ĬĹĬ		
NOTE: Not more than 4 corn on this certificate.	ers, all in the same town and	I range, may be recorded	12 31	32———3: 	33435	536-
			_			

A. Description of original monument and accessories and/or subsequent restoration:

Corner not set by original Government Surveyors 1923 - Kalamazoo County Road Commission found stone 6" Oak N. 72° E. 26.0' 24" Maple S. 43½° W. 40.0'

Road Commission also found stones at N.W. and S.W. corners of Section19, Cooper Township and they measured between them at 5314.5'. Road Commission also measured from stone at N.W. corner, Section 19 to stone at W.¼ corner, Section 19 at 2656.7'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Ingersoll, Watson & McMachen, Inc. prorated its mile to the Kalamazoo County Road Commission information and excavated to depth of about 6' and found nothing. IWM placed iron at prorated mile distance being 2652.35' South of stone at N.W. corner, Section 19 and 2653.44' North of stone at S.W. corner, Section 19. Also measured South from iron placed at W.¼ cor., Section 19 to iron found at E.¼ corner, Section 24, Alamo Township at 23.7' (Government 23.1').


RATIFIED
BY KALAMAZOO COUNTY
REMONUMENTATION
PEER GROUP
7-20-95

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

This position not established by original Government Surveyors. Iron placed is accepted as the best available evidence of the position of the corner. Removed iron rod and placed Harrison Monument and Mon. Box., Accessories:

Nail & Tab in N.W. face 16" Oak N. 27° E., 49.76' Nail & Tab in N.E. face 12" Hickory S. 30° E. 67.76' Nail & Tab in North face 10" Maple S. 50° W. 39.70' Nail & Tab in North face 14" Maple N. 80° W. 76.08'

Signed by OOLH M' Macka Surveyor's Michigan License No. 16

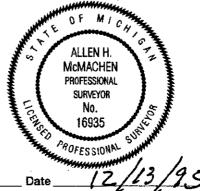

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971 REVISED MAY 14, 1975

REVISED MAY 14, 1975