,	1
2	/

OCT 0 6 1997

COMMISSION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

113	ER	2010	E 156	
CLERK - REGIST	Smid for	'97 JUL 29 AM 1:	STATE OF MICHOSON RECEIVED FOR REC	

For corners in Climax Twp.


<u>Kalamazoo</u>	Located In:	Corner Code #
(County)		
1. Public Land Survey	T <u>3S</u> R TR TR TR	9W H-05
2. Property Controlling in Section	S TR S TR	
3. Miscellaneous Property in Sec	S TR	

Register of Deeds Stamp & File Number

4. Lot No	Recorded Plat
5. Private Claims	

Robert E. Snell , in a field survey on May 28, 19<sup>97</sup> do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

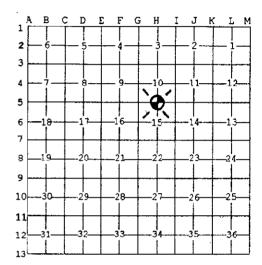

A. Description of original monument and accessories and/or subsequent restoration:

1826: United States Government Surveyors; set 1/4 Section post.

Wh. Oak 12"

S. 32° W. N. 74° W.

16 lks.

Wh. Oak 20"

25½ 1ks.

F. Hodgman, County Surveyor; "Found old stake, correct from one U.S. witness and 1883: one witness of resurvey standing. Bored  $3\frac{1}{2}$  deep, put in  $1\frac{1}{2}$  of small stones in bottom and 2 ft. earthen post over it."

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found tile on North side of fence to West and in line with fence to South offset tile 1997: and dug to 4' finding small stones to bottom of hole. Tile was 3" round and 1' in length. Replaced stones and tile and placed remonumentation sleeve over.



C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

H-05: South 1/4 Post, Section 10, T. 3 S., R. 9 W., ratified by the Kalamazoo County Remonumentation Program Peer Group on June 19, 1997 and is accepted as a careful and faithful perpetuation of the position of the original corner. Found 1' of 3" clay tile over  $1\frac{1}{2}$ ' of small stones as placed in 1883 by F. Hodgman, County Surveyor, in remonumentation survey. Placed remonumentation sleeve over tile.

PK Nail in North Side

4" Walnut

S. 68° E.

PK Nail in North Side

8" Oak

S. 42° E.

26.45

PK Nail in North Side

Quad 8" Maple

N. 84° W.

58.381

Signed by

Surveyor's Mighigan License No.