

WIGHTMAN WARD LANDCOR-Kalamazoo  
**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

<u>Kalamazoo</u> (County)	Located In:	Corner Code#
Pavilion Twp.		
1. Public Land Survey	T <u>3S</u> R <u>10W</u>	<u>F4</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

**SURVEY & REMONUMENTATION**

**FEB 08 2000**

**SECTION**

**Register of Deeds Stamp & File Number**

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

I, Gary D. Hahn, in a field survey on July 30, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

This corner not established by the G.L.O. Survey.

1888 - F. Hodgman: "C. at intersection of 1/4 lines. Set stake. Bk. Walnut 10" N 30° W 87 W. Oak 8" S 49° W 33½"

1896 - E. Strong County Surveyor: "Found stake bt. good. Set drag tooth in brick"

1988 - Ingersoll Watson & McMachen, Inc. Job No. 18300: Held found iron rod in mon. box as the center of section for their survey. According to the survey worksheet this iron was found to be 2.22 feet East of the North and South Quarter line and 0.84 feet South of the East and West Quarter line.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


Found a ½" diameter 24" long rebar in a monument box 3.5 feet West of centerline of 29<sup>th</sup> Street. Found a 1" x 1" x 10" long square drag tooth 29" below road surface surrounded by chunks of brick. Drag tooth is 0.19' East of the ½" diameter surface marker.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

F4, Center of Section 9, Town 3 South, Range 10 West. Ratified by the Kalamazoo County Remonumentation Peer Group on August 19, 1999. This position not established by original government surveyors. This monument is accepted as the best available evidence of the position of the corner. Set a 30" Harrison monument over drag tooth in a monument box.

Witness Ties: Found 2" pipe S 83° E 30.00 feet  
 Set Mag nail in fence post S 84° W 27.30 feet  
 Set Mag nail in stump N 29° E 65.74 feet  
 Set ½" diameter rebar N 81° W 50.19 feet

**RATIFIED**  
**BY KALAMAZOO COUNTY**  
**REMONUMENTATION**  
**PEER GROUP**  
 8-19-1999

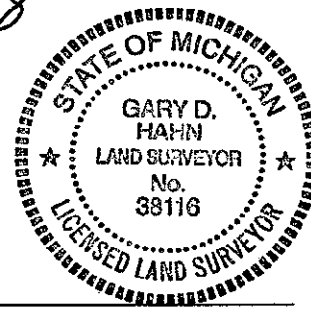

Signed by [Signature]  
 Surveyor's Michigan License No. 38116

Date 10/18/99