

RECORDS SECTION

NOV 15 1994

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

LIBER 003 PAGE 0242

REGISTER OF DEEDS  
*James H. [unclear]*

OCT 27 3 23 PM '94

RECORDED  
 LAKE COUNTY, MI.

For corners in

Lake (County)	Located In:		Corner Code #
	17N	11W	
1. Public Land Survey	T _____ R _____	J-1	
	T _____ R _____		
	T _____ R _____		
	T _____ R _____		
2. Property Controlling in Section	S _____ T _____ R _____		
	S _____ T _____ R _____		
3. Miscellaneous Property in Sec.	S _____ T _____ R _____		
	S _____ T _____ R _____		

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Robert L. Wetherell, in a field survey on October 10, 1994  
do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

**A. Description of original monument and accessories and/or subsequent restoration:**


J-1 - North 1/4 Corner Section 2, T17N, R11W, Chase Township, Lake County, Michigan  
 NOT SET BY ORIGINAL GOVERNMENT SURVEY

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

J-1 - North 1/4 Corner Section 2, T17N, R11W, Chase Township, Lake County, Michigan  
 Did not recover any monument at this location. Set the corner equal distance between the closing corners East and West on the Township Line. Distances both directions being 2658.33 feet. corner falls in center of East and West blacktop road in line with old fence berm to the South.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

J-1 - North 1/4 Corner Section 2, T17N, R11W, Chase Township, Lake County, Michigan  
 I set a 3/4" x 24" re-bar with Lake County Brass Cap in monument box and is accepted as a substantial monument for the corner.  
 8" Cedar N26°W 33.76' (60d spike in S.W. side of tree)  
 28" Maple S49°E 53.74' (60d spike in N.E. side of tree)  
 20" Maple S18°E 33.82' (60d spike in W. side of tree)  
 Brass Capped monument West 14.34' (S.1/4 Sec. 35, T18N, R11W) (3/4" x 24" re-bar with Lake County Brass Cap)

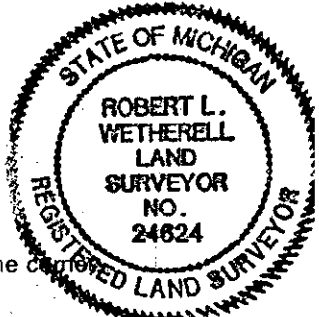

Signed by Robert L. Wetherell Date 10-26-94

Surveyor's Michigan License No. 24624  
 RATIFIED BY THE LAKE CO. PEER REVIEW GROUP  
 IN ACCORDANCE WITH P.A. 345  
 CHAIRMAN R.L.W.  
 DATE 10-25-94