

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

| FOR CORNERS OF--:                     | LOCATED IN--:  | CORNER CODE NUMBER     |
|---------------------------------------|--|------------------------|
| 1. PUBLIC LAND SURVEY                 | T. 18 N. R. 12 W.  | I-6                    |
| 2. PROPERTY CONTROLLING IN SECTION    | 15 T. 18 N. R. 12 W.                                     | 7; 14                  |
| 3. MISCELLANEOUS PROPERTY IN SECTION  | 15 T. 18 N. R. 12 W.<br>7, Sec. 15, and 664.42' N of I-6 | XX (664.42' S of Code) |
| 4. LOT NO. _____, RECORDED PLAT _____ |  |                        |
| 5. PRIVATE CLAIMS _____               |  |                        |

REGISTER OF DEEDS STAMP AND  
FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on September 5, 1974, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on September 5, 1974, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. Description of original monument and accessories and of subsequent restorations:~~

C. (continued)

XX

Set 1½"x2' Pipe  
 7" W. Oak N53°W 60.9  
 4" Maple S65°W 46.8  
 Set cedar post w/loc. tag  
                     Due W 33  
 Fence remains W on post & trees  
                     Due N 43'±

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- I-6 Reestablished corner equidistant and on line between section corners to north and south. There are irregular fence remains easterly, Due N, 45' (±10').
- 7 Established corner per standard B.L.M. instructions.
- 14 Established corner per standard B.L.M. instructions.
- XX Established NE corner of S½-S½-NE¼ of Sec. 15, per standard B.L.M. instructions. Corner falls approximately 9' west of N-S gravel road.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

| I-6                       | 7                         | 14                        |
|---------------------------|---------------------------|---------------------------|
| Buried D.N.R. Monument    | Set 1"x36" Pipe           | Set 1½"x36" Pipe          |
| 4" Maple N50°W 62.2       | Power Pole S38°E 68.62    | 14" R. Pine S37°W 75.7    |
| 8" W. Oak S52°W 59.7      | 4" Oak S70°W 39.5         | 6" W. Pine S65°W 36.6     |
| Set cedar post w/loc. tag | Set cedar post w/loc. tag | Set cedar post w/loc. tag |
| West 33                   | Due E 33                  | Due W 33                  |
| Center N-S gravel road    | Center N-S gravel road    | Center N-S gravel road    |
| Due E 12'±                | Due E 6'±                 | Due E 6'±                 |

SIGNED BY Carl F. Roser 9-4-75 DATE \_\_\_\_\_

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

MICHIGAN REGISTERED LAND SURVEYOR

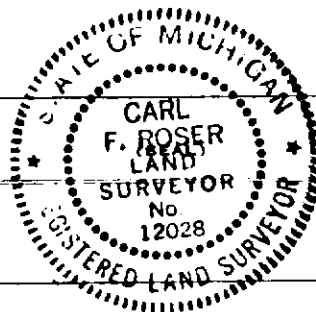

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_  
 CHERRY VALLEY TOWNSHIP  
 LAKE COUNTY