

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. 18 ^{N.} R. 12 ^{W.}	K-5; K-7
2. PROPERTY CONTROLLING IN SECTION 14	T. 18 ^{N.} R. 12 ^{W.}	5; 7
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ ^{N.} R. _____ ^{E.}	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND
FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on May 5, 1975, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. ~~Description of original monument and accessories and/or subsequent restoration:~~

C. (continued)

7
Set 1"x36" Pipe & cedar post
w/loc. tag
8" W. Oak N80°W 14.4
5" Maple N42°E 16.4

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- K-5 Reestablished corner by double proportion to U.S.; ½ mi. W - 1 mi. E - 1 mi. S - 2 mi. N.
- K-7 Recovered iron from F. Jones witness which fits remains of ^{ONE} ~~are~~ U.S.B.T. (pine stump). Old R.O.W. fence corner, fence S & W, is 21' S.
- 5 Established corner per standard B.L.M. instructions. Corner falls in east wheel track of old N-S township road grade.
- 7 Established corner per standard B.L.M. instructions.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-5	K-7	5
Set DNR mon. & cedar post	Found ½" pipe & added DNR mon.	Set 1"x3' Pipe
6" Oak N40°E 10.7	11" B. Oak N15°E 46.2	13" W. Pine N55°E 27.6
5" Oak S65°E 32.1	9" W. Oak S32°E 28.1	7" Oak N60°W 24.4
13" Oak S32°W 24.4	15" B. Oak S55°W 34.0	Set cedar post w/loc. tag
	set cedar post w/loc. tag	Due E 33
	Due N 33	Fence rem. E Due N 29±
		Fence rem. W Due N 36±

SIGNED BY Carl F Roser 9-4-75 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:


SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

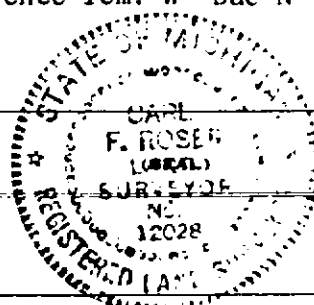

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ CHERRY VALLEY TOWNSHIP
LAKE COUNTY