

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF --:	LOCATED IN --:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>18</u> N. R. <u>12</u>	M-2; M-3; M-4; M-5
2. PROPERTY CONTROLLING IN SECTION <u>1</u>	, T. <u>18</u> N. R. <u>12</u>	7
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ S. R. _____ E.	
4. LOT NO. _____	, RECORDED PLAT _____	
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on April 29, 1975, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. Description of original monument and location and for subsequent restoration:~~

C. (continued)

M-5	7
Found iron & added DNR mon. & cedar post	Set 1"x30" Pipe
21" R. Pine S75°W 80.9	SW leg steel tower #3945
SW leg steel tower #3962	N20°E 143.4
N20°E 108.6	12" Cherry S25°W 87.3
	Set cedar post w/loc. tag
	Due W 33
	E-W RR Grade Due N 16

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- M-2 Reestablished corner single proportion to U.S. survey.
- M-3 Reestablished corner single proportion to U.S. and 45' W of Center of N-S power trans. line
- M-4 Reestablished corner per standard B.L.M. instructions. Corner falls in approximate center of N-S county road (sand).
- M-5 Found & accepted iron from two F. Jones witnesses, dated 1935.
- 7 Established corner single proportion to U.S. survey (G.L.O. plat).

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

M-2	M-3	M-4
Set DNR mon. & cedar post	Set DNR mon. & cedar post	Buried DNR monument
NW leg steel tower #3948	12" R. Pine S87°W 106.5	11" R. Oak S65°W 50.9
S20°E 139.7	5" R. Oak S45°W 72.5	5" W. Pine N70°W 75.2
8" Maple S60°W 35.8	Power Line East 45	SW leg steel tower #3957
Q Towers N&S Due E 62		N15°E 176.9
		Set cedar post w/loc. tag
		Due W 33

SIGNED BY Carl F. Roser 9-4-75 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:


SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

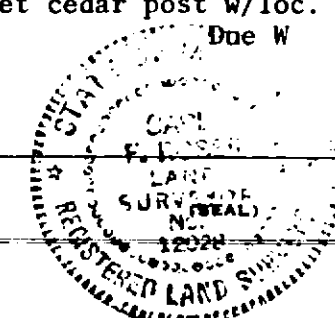

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ CHERRY VALLEY TOWNSHIP
LAKE COUNTY