

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>18</u> ^{N.} P. , R. <u>12</u> ^{E.} W.	<u>C-11; D-10; D-11;</u> E-10
2. PROPERTY CONTROLLING IN SECTION <u>29</u>	T. <u>18</u> ^{N.} S. , R. <u>12</u> ^{E.} W.	<u>14</u>
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ ^{N.} S. , R. _____ ^{E.} W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on June 13, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. Description of original monument and accessories and/or subsequent restoration~~
C. (continued)

E-10	14
Fd. 1/2" pipe & raised up with 1/2"X12" pipe	Fd. 3/4" round iron in ctr.N-S rd.
11" B.Oak N62°W 55.4	13" B.Oak S35°W 86.9
22" B.Oak N55°E 59.3	12" B.Oak N65°W 67.1
Set Ced.Post w/loc tag N45°W 33'	Set Ced.Post w/loc.tag Due W 33'
	Fd. ConcMon. S50°W 45.7

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- C-11 Fd. 3/4" rod (buried) that fits Blass Wits.
- D-10 Fd. 3/4" Ir. bar, buried in E-W road, for ctr. of Sec. 29. Fits Blass Wit.
- D-11 Fd. Conc. Mon (buried) in road intersection. Blass notes indicate he fd. a Conc. Mon. here in 1941. Conc. Mon. as recovered, this survey, fits Blass Wits.
- E-10 Fd. 1/2" pipe (buried) in road intersection; fits Blass Wit.
- 14 Fd. 3/4" Ir. Fits equidistant & on line between 1/4 Cor. N. and Sec. Cor. So.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-11	D-10	D-11
Fd. 3/4" Rod	Fd. 3/4" iron bar raised w/1"X10" pipe	Fd. 4"X4" Conc. Mon w/3/4" pipe in ctr.
20" B. Oak N38°E 71.7	11" B.Oak N52°E 52.9	18" B.Oak N45°E 54.61
9" W.Pine S72°E 63.2	6" B.Oak S23°E 34.8	17" B.Oak S25°E 49.35
17" B.Oak S28°W 27.5	4" B.Oak S43°W 34.6	Set Ced.Post w/loc.tag Due N 33'
Set Ced.Post w/loc.tag Due S 33'	Set Ced.Post w/loc.tag Due S 33'	
Ctr. E-W dirt rd Due N 4'+	Ctr. rd. N'ly Due W 17'	

SIGNED BY Carl F. Roser DATE 5-15-78


SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

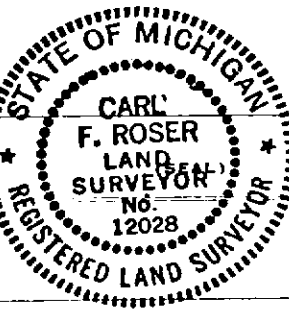

CHERRY VALLEY TOWNSHIP
LAKE COUNTY