


LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. PA 1970

For Corners In: Lake _____ (County)	Located In _____	Corner Code # _____
1. Public Land Survey	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S <u>27</u> T 18N R 12W	12
	S <u>27</u> T 18N R 12W	CWSE 1/64
3. Miscellaneous Property in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No: _____	Recorded Plat: _____	
5. Private Claims: _____		

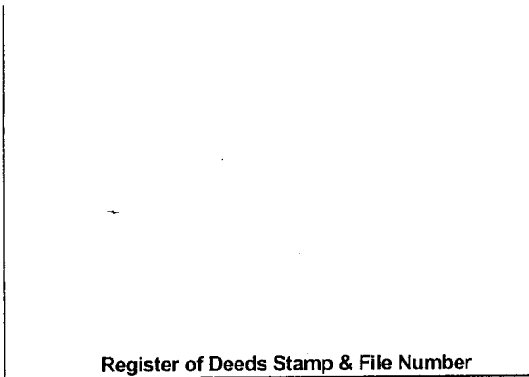

I, Craig W. McVean, in a field survey on Jan. 21, 2009 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

12 - 1988 - Unrecorded Survey Lakestate Surveyors File - CWSE 1/64 - None
4957-88, C. E. Cole - Survey marker set.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

<p><u>12</u> - CS 1/16 Cor. Sec. 27 - Fd. 1/2" CIR #17615 at single strand fence corner E & S being S1°05'W 1.33' from the calculated position for the corner. We agreed with Cole's survey numbers on his drawing. Thus rejected 1/2" CIR and set 2" Alum. Cap on 5/8" x 34" rebar per Standard BLM procedure.</p>	<p><u>CWSE 1/64</u> Cor. Sec. 27 - being the SE Cor. of the W 1/2 of the NW 1/4 of the SE 1/4 of Sec. 27 - Set 2' Alum. Cap on 5/8" x 34" rebar per Standard BLM procedure. S82°W 6.42' to Top Center of 4" Iron Fence pipe post in concrete. Metal pipe bar goes 13' North. E-W single strand is 1.7' South.</p>
---	---

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

<p><u>12</u> - Stamped 2" Alum. Cap on 5/8" x 34" rebar Set Blue Carsonite Post with loc. tag 1' NW N61°E 12.06' to set N & T in SE side 14" Oak N18°W 22.75' to set N & T in W. side 13" Oak S67°W 10.89' to set N & T in SE side 9" W. Oak S80°W 71.64' to set N & T in S. side 6" W. Pine S1°05'W 1.33' to fd. 1/2" CIR #17615</p>	<p><u>CWSE 1/64</u> - Stamped 2" Alum. Cap on 5/8" X 34" rebar Set Blue Carsonite Post with loc. tag 1' NW S74°E 69.55' to set N & T in N. side 7" W. Pine N3°W 3.51' to set N & T in W. side 14" W. Oak N32°W 44.21' to set N & T in NE side 7" W. Oak S71°W 43.60' to set N & T in S. side 19" W. Pine</p>
---	--

Signed by: Craig W. McVean
Surveyor's Michigan License No.: 39088

Date: 4/21/2009

