

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY.....	T. 19 N. R. 12 W.	H-3; H-4; I-2
2. PROPERTY CONTROLLING IN SECTION.....	T. N. S. R. W.	
3. MISCELLANEOUS PROPERTY IN SECTION.....	T. N. S. R. W.	
4. LOT NO. ...., RECORDED PLAT.....		
5. PRIVATE CLAIMS.....		

REGISTER OF DEEDS STAMP AND  
FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on October 18, 1979, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- 4-3 Reestab.  $\frac{3}{4}$  corner, Sec. 3, equidistant between the SE & SW corners of Sec. 3 & in center of E-W bit-surfaced road. Corner is in line with fence remains to N & S.
- 4-4 Estab. center of Sec. 10 at intersection of  $\frac{1}{4}$  lines; a post hole (possible fence corner) with old fence S'y & wire in trees E'y is N11°E 37'. Corner falls in approximate NE'y cleared powerline R.O.W.
- 1-2 Reestab.  $\frac{1}{4}$  corner to Sec. 2 & 3 in center of N-S b'top road & in line with old fence to E. This  $\frac{1}{4}$  corner by occupancy fits U.S. stream tie to N & comes close to fitting survey by J. W. Nichoson, Co. Surv., Aug. 1907; Lake Co. Surveyor's Record. A corner position by proportion to J.W.N. mea. of W line of Sec. 2 would be 7' N.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

H-3	H-4	I-2
Drove 3/4"x21" pipe in ctr. E-W bit. road	Set 5/8"x34" rerod w/RLS cap & cedar post w/loc. tag	Drove 5/8"x34" rerod w/RLS cap
3" R. Pine S55°W 72.75	3" R. Pine N15°E 38.5	6" W. Oak N45°W 43.7
11" B. Oak S15°E 84.65	4" Maple S50°E 47.8	9" W. Oak N40°E 55.3
Set ced.post w/loc.tag	NE leg steel tower #3884	Set treated post w/loc. tag
Due N 33'	S15°W 63.5	Due W 33'
Approx. E-W ROW fn. (dn.)		Old fn. corner (fn. N-S-E)
Due N 35'±		Due E 33'
Approx. ROW fn.cor. (dn.)		
Due S 49'±		

SIGNED BY: Carl F. Roser DATE: 7-9-80

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY: \_\_\_\_\_ DATE: \_\_\_\_\_

APPROVED AND SIGNED BY: \_\_\_\_\_ DATE: \_\_\_\_\_

CHIEF OF SURVEY PARTY

MICHIGAN REGISTERED LAND SURVEYOR

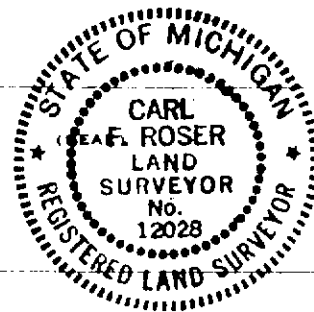

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_

SOUTH NEWKIRK TOWNSHIP  
LAKE COUNTY