

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY.....	T. 19 N. R. 12 W.	I-4; I-5
2. PROPERTY CONTROLLING IN SECTION- 10	T. 19 N. R. 12 W.	12; 16
3. MISCELLANEOUS PROPERTY IN SECTION-----	T. S. R. E. W.	
4. LOT NO.-----, RECORDED PLAT-----		
5. PRIVATE CLAIMS-----		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on October 9, 1979, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and subsequent restoration:

- C. (continued)
- 16
 - Set 5/8"x34" rerod w/RLS cap & cedar post w/loc. tag
 - 4" Maple N10°W 0.9
 - 15" W. Pine S20°E 13.2
 - 4" Maple S70°W 9.2
 - Ctr. gravel road Due S 133'

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- 1-4 Fd. & accepted RR spike 0.7'E of ctr. of N-S bit.-surface road. Corner is in line with old fence E'ly & some wire in trees & a few posts W'ly. J.W. Nicholson notes indicate he reestablished the E $\frac{1}{4}$ corner of Sec. 10 by single proportion in Sept.1907.
- I-5 Fd. 1/2" pipe outside of irreg. road intersection. Corner is in line with ctr. of bit.-surface road looking N & in line with N edge of gravel road looking W. Corner is on line & double distance across the fd. NE cor. & E $\frac{1}{4}$ cor. of Sec. 10.
- 12 Established NW cor. of SW-SE, Sec. 10, per std. B.L.M. instructions.
- 16 Established 1/8 corner per std. B.L.M. instructions.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-4	I-5	12
Fd. RR spike	Fd. 1/2" pipe	Set 5/8"x34" rerod w/RLS cap & cedar post w/loc. tag
7" R. Pine N30°E 95.64	Power Pole N40°W 81.87	cap & cedar post w/loc. tag
13" W. Oak S50°E 54.86	12" W. Oak N60°W 55.11	3" W. Pine N40°W 22.3
Fd. 1/2"x1/2" sq. iron by 1 1/2" pipe	10" R. Pine N50°E 113.30	7" W. Oak N45°E 28.2
Due E 33.0	Set ced.post w/loc. tag	Fd. 1 1/4" pipe at old fn.cor.
Set ced.post w/loc. tag	N45°W 66'	N & E N00°08'E 94.75
Due W 33'		

SIGNED BY Carl F. Roser 7-9-80

DATE

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:


SIGNED BY _____
CHIEF OF SURVEY PARTY

DATE

APPROVED AND SIGNED BY _____
MICHIGAN REGISTERED LAND SURVEYOR

DATE

(SEAL)

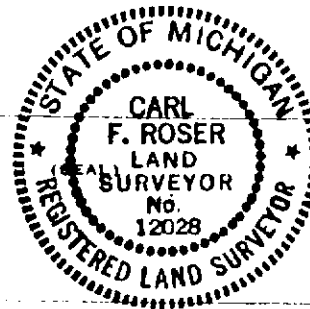

SURVEYOR'S MICHIGAN REGISTRATION NO.

SOUTH NEWKIRK TOWNSHIP
OSCEOLA COUNTY