

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

| FOR CORNERS OF--                      | LOCATED IN--      | CORNER CODE NUMBER |
|---------------------------------------|-------------------|--------------------|
| 1. PUBLIC LAND SURVEY                 | T. 19 N. R. 12 W. | C-2; D-2; E-2; F-3 |
| 2. PROPERTY CONTROLLING IN SECTION    | T. S. R. E. W.    |                    |
| 3. MISCELLANEOUS PROPERTY IN SECTION  | T. S. R. E. W.    |                    |
| 4. LOT NO. _____, RECORDED PLAT _____ |                   |                    |
| 5. PRIVATE CLAIMS _____               |                   |                    |

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on November 9, 1979, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. Description of original monument and its location and subsequent restoration:~~

C. (continued) F-3  
 Drove 3/4"x27" pipe, flush.  
 7" B. Oak N50°W 72.4  
 10" W. Oak S10°E 56.4  
 Set cedar post w/loc. tag  
 Due N 33'

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

C-2 Fd. & accepted old steel fence post (buried) as previously used by RLS Clint Cole to subdivide Sec. 6

D-2 Established center of Sec. 5 at intersection of one-quarter lines.

E-2 Reestablished E 1/4 corner of Sec. 5 single proportion to 1838 G.L.O. survey.

F-3 Reestablished S 1/4 corner Sec. 4, equidistant & on line between the SE & SW corners of Sec. 4. Corner falls in center of E-W b'top road.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

|                            | C-2 | D-2  |  | E-2                       |
|----------------------------|-----|--|--|---------------------------|
| Fd. old steel fence post.  |     | Set 5/8"x34" rerod & cedar post w/loc. tag |  | Set DNR Mon. & Cedar Post |
| Fd. iron in conc., NW cor. |     |  |  | 3" W. Oak N40°E 23.0      |
| "Twin creek plat"          |     | 7" B. Oak N10°W 20.3                       |  | 12" B. Oak S35°E 29.5     |
| S20°12'E 96.38             |     | 9" B. Oak N45°E 19.8                       |  | 6" B. Oak S60°W 26.4      |
| 8" R. Pine N50°E 50.5      |     | 3" W. Oak S15°W 7.4                        |  |                           |
| 7" B. Oak S65°E 37.3       |     | Ctr. Twin Creek Due E 340'                 |  |                           |
| Set cedar post w/loc. tag  |     |  |  |                           |
| Due E 33'                  |     |  |  |                           |
| Ctr. N-S dirt rd.          |     |  |  |                           |
| Due W 2'                   |     |  |  |                           |


SIGNED BY Carl F. Roser DATE 7-9-80

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

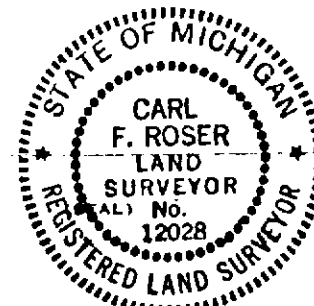

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_ SOUTH NEWKIRK TOWNSHIP  
 LAKE COUNTY