


LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. PA 1970

For Corners In: Lake _____ (County) _____	Located In T <u>19N</u> R <u>12W</u> <u>G7</u> T _____ R _____	Corner Code # _____ _____	
2. Property Controlling in Section	S _____ T _____ R _____ S _____ T _____ R _____	_____ _____	
3. Miscellaneous Property in Section	S _____ T _____ R _____ S _____ T _____ R _____	_____ _____	
4. Lot No: _____	Recorded Plat: _____		
5. Private Claims: _____			

Register of Deeds Stamp & File Number

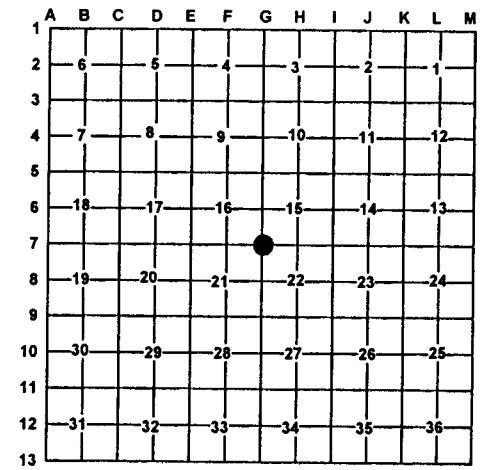

I, Craig W. McVean, in a field survey on May 2, 2001 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- G7 - GLO - set post - S. Sibley - 1838.
 B. Oak 8" S13°E 28L.
 Pine 10" N37°W 31L.
- J. W. Nicholson - 1908 - located & perpetuated and on record.
- G.H. Johnson - pipe drove in wagon track (North side)
 B. Oak 7" N56°E 25 Pine stp. 28" N45°W 95
- F. Jones - 1930's - B. Oak 10" N7°E 63';
 B. Oak 16" N69 1/2 °W 54' 4"; B. Oak 12" S3°E 49 1/2'
- G. Blass- 1960 - Fd. 1 1/4" well point in N. edge of Rd. E-W 8" W. Oak N45°W 84.55'; 15" B. Oak N20°E 58.93' (OBT) 18" B. Oak S15°E 58.95' (OBT); 26" B. Oak N75°W 41.55' (OBT).
- LCRC-L. 2, pg. 245-C.F. Roser - 1975 - fd. pipe that fits irons 1/4 & 1/2 miles E. and has been used by G. Blass. Add DNR mon. - 12" R. Pine N5°E 78.11'; 16" R. Pine N42°E 120.64' 11" W. Oak N45°W 84.4'; Set Cedar post with Loc. tag N. 33' Center of E-W Gravel Rd. South 18'

B. Description of corner evidence found and/or method applies in restoring or re-establishing corner:

- G7 - Sec. corner common to sec. 15' 16' 21' & 22' - Fd. 4" DOC (DNR) Alum. cap on 1" iron pipe with 1 1/4" iron pipe on E. side, on N. edge of E-W gravel Rd. fits witnesses by Blass & Roser. Fd. remains of Johnson's PS BT to NW that fits Mon. DOC (DNR) mon. accepted as the best available evidence of the position of original corner.
- Reference Pt. - C.F. Roser notes on DNR working drawing that he found & removed F. Jones iron being 11.3' E. & 6.9' S. of DOC mon. location on 6-20-1974. F. Jones position not utilized as G7 in this survey.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- G7 - DOC (DNR) 4" Alum. Cap on 1" Iron pipe. Add tin cap with concrete around cap. Set Blue Carsonite post with location tag & reset cedar post with location tags 33' N. S16°E 59.17' to set N&T in W. side 28" B. Oak (FJ, GB, CFR) N48°W 84.97' to set N&T in W. side 16" W. Oak (GB, CFR) N2°E 77.89' to set N&T in E. side 18" R. Pine (CFR) N40°E 120.69' to set N&T in NW side 19" R. Pine (CFR) N14°W 28.88' to set N&T in W side 10" W. Pine scribed 'XBT' N46°W 62.4' to CL remains of 28" PS (GHJ)



Signed by: Craig W. McVean
 Surveyor's Michigan License No.: 39088

Date: 11/26/2001