# LAND CORNER RECORDATION CERTIFICATE

**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in
LAKE
(County)

| | Located In: | Corner Code ## |
|---|---|---|
| 1. Public Land Survey | T 20N R 13W | I-9, J-9, |
| | T ___ R ___ | K-8 |
| | T ___ R ___ | |
| | T ___ R ___ | |
| 2. Property Controlling | S 23 T ___ R ___ | 16 |
| in Section | S ___ T ___ R ___ | |
| 3. Miscellaneous | S ___ T ___ R ___ | |
| Property in Sec. | S ___ T ___ R ___ | |

**Register of Deeds Stamp & File Number**

4. Lot No. _____ , Recorded Plat _____
5. Private Claims _____

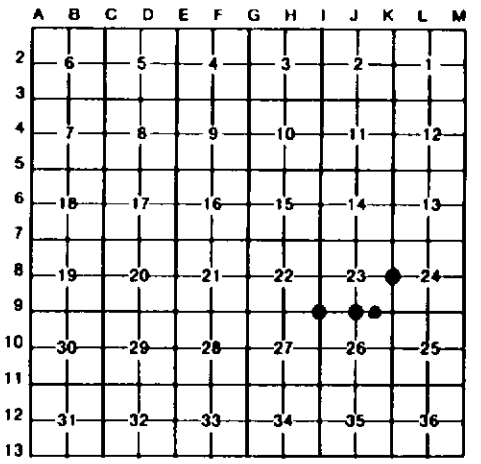


I, CARL T. KIISKILA , in a field survey on JULY 5, , 19 94 , do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

I-9 J-9 K-8

(NO EVIDENCE OF G.L.O. CORNER, B.T'S, LINE TREES & TOPOGRAPHY, AS CALLED OUT IN THE G.L.O. LINE NOTES; UNLESS NOTED IN ITEM "B" BELOW.)

16

STATE OF MICHIGAN
CARL KIISKILA
LAND SURVEYOR
No. 33981
LICENSED LAND SURVEYOR

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I-9
FD CONC MON FOR NW COR S-26. G. BLASS FD FENCE POST IRON HERE IN 1956. COR USED IN 1983 CERT OF SURVEY BY R.WETHERELL (LI 2, PG 438) & 1987 CERT OF SURVEY BY C.COLE (LI 3, PG 117).

J-9
FD 1/2" REROD FOR N 1/4 COR S-26 AS SET BY C.COLE IN 1977, LI 2 PG 304. COR IS MIDWAY & ON LINE BETW SEC CORS 1/2 MILE EAST & WEST. CTR OF E-W SAND ROAD IS 2' NORTH.

K-8
FD CONC MON W/BRASS CAP STAMPED "T20N-R13W GEORGE BLASS #5489" FOR W 1/4 COR S-24. COR FITS SURVEY INFO OF S-24 BY BLASS SURVEYS & S-23 INFO BY LAKE STATES SURVEY.

16
FD 1/2" REROD FOR SW COR OF SE 1/4 OF SE 1/4 S-23. COR SET BY C.COLE, 1976 CERT OF SURVEY, LI 2, PG 07. CTR OF E-W SAND ROAD IS 2' NORTH.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-9
FD USFS CONC BRASS CAP MON IN SAND/GRVL RD INTER N-S-E-W.

| | | |
|---|---|---|
| POWER POLE | N45°W | 52.42' |
| #29" B OAK | N35°E | 87.79' |
| #12" R PINE | N50°E | 129.58' |
| #11" R PINE | S40°W | 95.04' |
| #13" R PINE | S60°W | 64.80' |
| #33" CTR B OAK | S65°W | 97.8' |

#=PS RAG 1967 WIT.
#=RLS G.BLASS 1956 WIT.

J-9
FD 1/2" REROD.

| | | |
|---|---|---|
| #16" B OAK | N52°E | 40.38' |
| #14" B OAK | S28°E | 48.74' |
| 24" B OAK | S25°W | 51.2' |
| 3" B CHERRY | S38°W | 30.0' |

FD 1/2" REROD W/RLS CAP & 1 1/4"GUARD PIPE NORTH 33.0'
#=RLS C.COLE 1987 WIT.

K-8
FD BRASS CAP IN CONC MON. ADDED CED POST.

| | | |
|---|---|---|
| 11" R OAK | N20°W | 10.56' |
| 7" MAPLE | N40°E | 10.07' |
| 8" R OAK | S15°W | 10.93' |
| 3" W PINE | N85°W | 14.08' |

16
FD 1/2" REROD.

| | | |
|---|---|---|
| 10" OAK | N25°E | 28.1' |
| 4" MAPLE CLP | S15°E | 74.8' |
| 6" MAPLE CLP | S24°W | 29.7' |

SET CED POST W/LOC TAG AT FD 1/2" REROD W/RLS CAP NORTH 33.0'

Signed by Carl T Kiiskila Date 5-16-97

Surveyor's Michigan License No. 33981

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983